

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

**DISTRICT I**  
P.O. Box 1980, Hobbs, NM 88240  
**DISTRICT II**  
P.O. Drawer DD, Artesia, NM 88210  
**DISTRICT III**  
300 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-025-24294
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LG-1333
7. Lease Name or Unit Agreement Name Midwest <input checked="" type="checkbox"/> State
8. Well No. 1
9. Pool name or Wildcat Undes. Saunders Permo Upper Penn

**SUNDRY NOTICES AND REPORTS ON WELLS**

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.

Type of Well:  
OIL WELL ☐ GAS WELL ☐ OTHER P & A Well

Name of Operator  
YATES PETROLEUM CORPORATION

Address of Operator  
105 South 4th St., Artesia, NM 88210

Well Location  
Unit Letter B : 660 Feet From The North Line and 1980 Feet From The East Line

Section 19 Township 14S Range 33E NMPM Lea County  
10. Elevation (Show whether DF, RKB, RT, GR, etc.)  
4262' GR

1. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
DILL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged and abandoned well as follows:

Moved in and rigged up pulling unit. No tubing in well. Ran 5-1/2" gauge rings to 9550'. Ran 5-1/2" CIBP to 9550' and set. Dumped 25' of cement on top of CIBP. Unflanged tubinghead. Started digging out cellar. Cellar had cement in it. Chipped cement at wellhead down to 2" opening on wellhead. Wellhead did not have bullplug or valve. Unflanged 5-1/2" wellhead. Welded onto 5-1/2" casing. Worked 5-1/2" casing. Free point showed to be at 5500'. RIH w/shot and cut 5-1/2" casing at 5410'. Pulled and laid down 5-1/2" casing. RIH w/tubing. Tag cement plug at 4092'. POOH w/tubing. Break down 8-5/8" wellhead. Latch onto 8-5/8" casing. Work 8-5/8" casing and got free point at 675'. RIH and cut off 8-5/8" casing at 658'. Pulled and laid down 8-5/8" casing. RIH w/tubing to 1600'. Spotted 30 sacks cement. Pulled up to 708' (5-1/2" stub). Spotted 50 sacks cement. WOC. RIH and tag cement plug at 592'. Pulled to 465' (13-3/8" shoe). Spotted 75 sacks cement. WOC. RIH w/tubing & tag plug at 359'. Laid down tubing. Set 15 sack cement plug at surface. Installed regulation

abandoning marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging complete 7-28-93.  
I hereby certify that the information above is true and complete to the best of my knowledge and belief.  
SIGNATURE Rusty Klein TITLE Production Clerk DATE Sept. 7, 1993  
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505/748-1471

(This space for Staff Use)

APPROVED BY GARY W. WINK

CONDITIONS OF APPROVAL, IF ANY:

Approved as to plugging of the Well Bore.  
Liability under bond is retained until  
surface restoration is completed.

DATE

JAN 20 1994

**RECEIVED**

SEP 08 1993

UCLH HODGS  
OFFICE