

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. K-3714

## SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator M & W, OF LOVINGTON, INC.	8. Farm or Lease Name CITIES SERVICE STATE
3. Address of Operator BOX 922 LOVINGTON, NEW MEXICO 88260	9. Well No. 1
4. Location of Well UNIT LETTER E 1980 FEET FROM THE NORTH LINE AND 660 FEET FROM THE WEST LINE, SECTION 26 TOWNSHIP 14S RANGE 34E NMPM.	10. Field and Pool, or Wildcat HIGH PLAINS PENN
15. Elevation (Show whether DF, RT, GR, etc.) 4084 GL	12. County LEA

### 16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

### 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. SET BRIDGE PLUG & COVER WITH SAND @ 10,437'.
2. SET CEMENT RETAINER @ 10,350' EZ DRILL.
3. LOAD BACK SIDE & PRESSURE TO 500#.
4. SQUEEZE PERFS FROM 10,401' TO 10,409' WITH 100 SACKS OF CLASS H CEMENT HALLIBURTON
5. WAIT 24 HRS. ON CEMENT.
6. DRILL OUT CEMENT & PRESSURE TEST CASING TO 1500# FOR 30 MIN.
7. WASH SAND OFF BRIDGE PLUG & PULL.
8. RETURN WELL TO PRODUCTION FROM PERFS 10446'-10462'.

### 18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Jerry Sexton</u>	TITLE <u>PRESIDENT</u>	DATE <u>8-18-84</u>
ORIGINAL SIGNED BY JERRY SEXTON DISTRICT I SUPERVISOR		
APPROVED BY _____	TITLE _____	DATE <u>FEB - 4 1985</u>

CONDITIONS OF APPROVAL, IF ANY: