

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name	
2. Name of Operator Adobe Oil Company		8. Farm or Lease Name Sanders	
3. Address of Operator 1100 Western United Life Bldg. - Midland, Texas 79701		9. Well No. 1	
4. Location of Well UNIT LETTER G , 1980 FEET FROM THE North LINE AND 1780 FEET FROM THE East LINE, SECTION 27 TOWNSHIP 13-S RANGE 34-E NMPM.		10. Field and Pool, or Wildcat Cerca (Upper Penn)	
15. Elevation (Show whether DF, RT, GR, etc.)		12. County	

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 10-31-75: Pulled tubing and set CIBP at 10250'. Dumped 4 sx (40') cement on top of bridge plug. Mixed mud and started loading hole.
- 11-1-75: Finished loading hole with 10# mud. Cut off casing at 5060'.
- 11-3-75: Laid down casing and went in hole with tubing. Spotted 40 sx cement plug 4900 - 5048'. Pulled up tubing and spotted 40 sx plug 4213 to 4361'.
- 11-4-75: Pulled tubing and cut off 8-5/8" casing at 1078'. Pulled casing and went in hole with tubing and spotted 65 sx cement plug 978 - 1078' and 65 sx plug 378 - 478'. Pulled tubing and put in 5 sx plug 0 - 10'.
- 11-5-75: Welded plate on casing and installed marker.

DA&S at Hobbs, New Mexico, did all the casing pulling and plugging work.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Eddie Sear</u>	TITLE <u>Vice President</u>	DATE <u>11-6-75</u>
APPROVED BY <u>Eddie Sear</u>	TITLE <u>OIL & GAS INSPECTOR</u>	DATE <u>JUN 14 1976</u>
CONDITIONS OF APPROVAL, IF ANY:		