	Form C-123 Supersedes Old C-102 and C-103
NEW MEXICO OIL CONSERVATION COMMISS	SION Effective 1-1-55
PFFICE	5a. Indicate Type of Lease State X Fee
OR	5. State Oil & Gas Leage No.
SUNDRY NOTICES AND REPORTS ON WELLS 10 NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A COPPER ON RES USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	EHVOIR.
MELL STHER.	7. Unit Agreement Manne G
Saxon Oil Company	8. Form or Lease Name State "35"
P. O. Box 2948, Midland, Texas 79701	9. Well 115.
G 1980 North 1980 UNIT LETTER O	10. Field and Pool, or Wilacet Tulk/Penn
East LINE, SECTION 35 TOWNSHIP 14-S HANGE 32-	E
15, Elevation (Show whether DF, RT, GR, etc.) 4284 GL	12. County Lea
Check Appropriate Box To Indicate Nature of Notice, 1	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON A REMEDIAL WORK TEMPORARILY ABANDON COMMENCE DESELVING OF	ALTERING CASING
PULL OR ALTER CASING CHANGE PLANS CASING TEST AND COME OTHER Fina	TT JGS
OTHER	X.
17. Describe Progosed or Completed Operations (Clearly state all pertinent details, and stee perform work) SEE RULE 1103.	autes, including estimated dark of charting any proposed
Started plugging 1-17-76.	
<pre>1 - Set 5-1/2" CIBP @ 9700' Cap w/35' of cmt. 2 - Cut 5-1/2" csg @ 8174' Left 5-1/2" csg in hole from 8224' to 8124'. Spot 40 sx from 7658' to 7558' Spot 40 sx from 4135' to 4035'. Spot 40 sx from 1700</pre>	, spot 40 sx from 5300' to 5200'
 2 - Cut 5-1/2" csg @ 8174' Left 5-1/2" csg in hole from from 8224' to 8124'. Spot 40 sx from 7658' to 7558' Spot 40 sx from 4135' to 4035', Spot 40 sx from 1700 3 - Cut 8-5/8" csg. @ 1402' and pull. Left 8-5/8" in ho Spot 80 sx plug @ 1452' to 1352', Spot 100 sx plug f 	, spot 40 sx from 5300' to 5200', ' to 1600'. le from 4085' to 1402'. rom 450' to 350'. Spot 10 sx
<pre>2 - Cut 5-1/2" csg @ 8174' Left 5-1/2" csg in hole from from 8224' to 8124'. Spot 40 sx from 7658' to 7558' Spot 40 sx from 4135' to 4035', Spot 40 sx from 1700 3 - Cut 8-5/8" csg. @ 1402' and pull. Left 8-5/8" in ho</pre>	, spot 40 sx from 5300' to 5200', ' to 1600'. le from 4085' to 1402'. rom 450' to 350', Spot 10 sx. from 400' to surface.
 2 - Cut 5-1/2" csg @ 8174' Left 5-1/2" csg in hole from from 8224' to 8124'. Spot 40 sx from 7658' to 7558' Spot 40 sx from 4135' to 4035', Spot 40 sx from 1700 3 - Cut 8-5/8" csg. @ 1402' and pull. Left 8-5/8" in ho Spot 80 sx plug @ 1452' to 1352', Spot 100 sx plug f plug at surface - 400' of 13-3/8" csg. left in hole 	, spot 40 sx from 5300' to 5200', ' to 1600'. le from 4085' to 1402'. rom 450' to 350', Spot 10 sx. from 400' to surface.
 2 - Cut 5-1/2" csg @ 8174' Left 5-1/2" csg in hole from from 8224' to 8124'. Spot 40 sx from 7658' to 7558' Spot 40 sx from 4135' to 4035', Spot 40 sx from 1700 3 - Cut 8-5/8" csg. @ 1402' and pull. Left 8-5/8" in ho Spot 80 sx plug @ 1452' to 1352', Spot 100 sx plug f plug at surface - 400' of 13-3/8" csg. left in hole 4 - Welded marker, cleaned up - Clean up has been done. Job Completed 1-24-76 	, spot 40 sx from 5300' to 5200', ' to 1600'. le from 4085' to 1402'. rom 450' to 350', Spot 10 sx. from 400' to surface.
 2 - Cut 5-1/2" csg @ 8174' Left 5-1/2" csg in hole from from 8224' to 8124'. Spot 40 sx from 7658' to 7558' Spot 40 sx from 4135' to 4035', Spot 40 sx from 1700 3 - Cut 8-5/8" csg. @ 1402' and pull. Left 8-5/8" in ho Spot 80 sx plug @ 1452' to 1352', Spot 100 sx plug f plug at surface - 400' of 13-3/8" csg. left in hole 4 - Welded marker, cleaned up - Clean up has been done. Job Completed 1-24-76 	, spot 40 sx from 5300' to 5200', ' to 1600'. le from 4085' to 1402'. rom 450' to 350', Spot 10 sx. from 400' to surface.
 2 - Cut 5-1/2" csg @ 8174' Left 5-1/2" csg in hole from from 8224' to 8124'. Spot 40 sx from 7658' to 7558' Spot 40 sx from 4135' to 4035', Spot 40 sx from 1700 3 - Cut 8-5/8" csg. @ 1402' and pull. Left 8-5/8" in ho Spot 80 sx plug @ 1452' to 1352', Spot 100 sx plug f plug at surface - 400' of 13-3/8" csg. left in hole 4 - Welded marker, cleaned up - Clean up has been done. Job Completed 1-24-76 	, spot 40 sx from 5300' to 5200', ' to 1600'. le from 4085' to 1402'. rom 450' to 350', Spot 10 sx. from 400' to surface.
 2 - Cut 5-1/2" csg @ 8174' Left 5-1/2" csg in hole from from 8224' to 8124'. Spot 40 sx from 7658' to 7558' Spot 40 sx from 4135' to 4035', Spot 40 sx from 1700 3 - Cut 8-5/8" csg. @ 1402' and pull. Left 8-5/8" in ho Spot 80 sx plug @ 1452' to 1352', Spot 100 sx plug f plug at surface - 400' of 13-3/8" csg. left in hole 4 - Welded marker, cleaned up - Clean up has been done. Job Completed 1-24-76 	, spot 40 sx from 5300' to 5200', ' to 1600'. le from 4085' to 1402'. rom 450' to 350', Spot 10 sx. from 400' to surface.
<pre>2 - Cut 5-1/2" csg @ 8174' Left 5-1/2" csg in hole from from 8224' to 8124'. Spot 40 sx from 7658' to 7558' Spot 40 sx from 4135' to 4035', Spot 40 sx from 1700 3 - Cut 8-5/8" csg. @ 1402' and pull. Left 8-5/8" in ho Spot 80 sx plug @ 1452' to 1352', Spot 100 sx plug f plug at surface - 400' of 13-3/8" csg. left in hole 4 - Welded marker, cleaned up - Clean up has been done. Job Completed 1-24-76 Clean up Job Completed 4/15/76.</pre>	, spot 40 sx from 5300' to 5200', ' to 1600'. le from 4085' to 1402'. rom 450' to 350', Spot 10 sx. from 400' to surface.

CONDITIONS OF APPROVAL, IF AN GOOD AND