

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.
K-6678-1

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
SEE INSTRUCTIONS FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- Dry Hole	7. Unit Agreement Name -
2. Name of Operator TEXACO Inc.	8. Form or Lease Name New Mexico 'DP' State
3. Address of Operator P. O. Box 728 - Hobbs, New Mexico 88240	9. Well No. 1
4. Location of Well UNIT LETTER B 810 FEET FROM THE North LINE AND 1980 FEET FROM THE East LINE, SECTION 19 TOWNSHIP 12-S RANGE 34-E NMPM.	10. Field and Pool, or Wildcat Undesignated
15. Elevation (Show whether DF, RT, GR, etc.) 4207' (DF)	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> OTHER <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER <input type="checkbox"/>
PLUG AND ABANDON <input checked="" type="checkbox"/> CHANGE PLANS <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Set CIBP at 9650' and spot 35' (5 sx) cement on top.
2. Load hole with mud (25 sx gel per 100 bbls water).
3. Spot 100' (15 sx) cement plug at 4100'.
4. Cut 5-1/2" casing at 500' and pull.
5. Cut 8-5/8" casing at 500' and pull.
6. Spot 100' (100 sx) cement plug across casing stubs.
7. Spot 100' (100 sx) cement plug across surface casing shoe at 350'.
8. Spot 10' (10 sx) cement plug at surface.
9. Install marker and clean location.

**** 100' plug across top and bottom of salt section**

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED  TITLE **Asst. District Supt.**

DATE **4-12-76**

Orig. Signed By

Jerry Sexton

Asst. 1. Supt.

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY

APR 12 1976