

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease

State ☐

Fee ☒

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- 2. Name of Operator DyAd Associates 3. Address of Operator 1107 Petroleum Bldg. - Midland, Texas 79701 4. Location of Well UNIT LETTER G 1980 FEET FROM THE North LINE AND 1700 FEET FROM THE East LINE, SECTION 25 TOWNSHIP 12-S RANGE 37-E NMPM. 15. Elevation (Show whether DF, RT, GR, etc.) G. L. 3873	7. Unit Agreement Name 8. Farm or Lease Name Fields 9. Well No. 1 10. Field and Pool, or Wildcat Gladiola 12. County Lea
---	--

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

3/21/85: Pulled rods and tubing. Set Pengo CIBP at 9100 feet. Dumped 3 sacks of Class "C" cement on top. Set Pengo CIBP at 8100 feet. Dumped 3 sacks of cement on top. Attempt to cut and pull 5½" pipe from 8000 feet, not free. Determine free point. Cut and pulled 5300 feet of 5½" pipe. Circulate hole with 10# mud. Spot 50 sacks of Class "C" cement at 5950 feet. Tag plug at 5837 feet. Spot 50 sacks plug at 4500 feet. Pull to 200 feet. Mix mud. Spot 60 sacks of Class "C" cement. Trip out. Remove wellhead. Cut off pipe. Weld on steel plate and marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 

TITLE Oper. Mgr. - T.A.P.S., INC.

DATE

Eddie W. Seay

Oil & Gas Inspector

APPROVED BY

TITLE

DATE

APR 25 1985

CONDITIONS OF APPROVAL, IF ANY: