

State No. 16-2

Workover Procedure

16. RIH production tubing and packer. Set packer at 11,200'.
17. ND BOP's. NU xmas tree. RDMO workover rig.
18. RU WLU. RU 5000# lubricator. RIH with thru tubing perforating gun and perf Limestone at 11,313-322, decentralized, 0-degree phased, 4 SPF. RD WLU.
19. Flow test well to production equipment. Swab well in if necessary. If necessary, acidize well as per attached recommendation.
20.
 - A. If well produces at commercial rate, file completion report with New Mexico Conservation Commission. Final report. Report daily production to Engineering in Houston.
 - B. If well produces at noncommercial rates, begin plug and abandonment procedure.

