| District I Energ | State of New Mexico | Form C-103 Revised March 25, 1999 |
|--|--|--|
| 1 (AC) T 1 IN 11.11. NIX (90340 | | |
| 1625 N. French Dr., Hobbs, NM 88240 District II | | WELL API NO. 30-025-28178 |
| 811 South First, Artesia, NM 88210 OIL | CONSERVATION DIVISION | 5. Indicate Type of Lease |
| District III | 2040 South Pacheco | STATE E FEE |
| 1000 Rio Brazos Rd., Aztec, NM 87410 District IV | Santa Fe, NM 87505 | 6. State Oil & Gas Lease No. |
| 2040 South Pacheco, Santa Fe, NM 87505 | | Fee lease |
| SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH | | 7. Lease Name or Unit Agreement Name: |
| PROPOSALS.) 1. Type of Well: | | RICHARDSON FEE |
| | ther | |
| 2. Name of Operator | | 8. Well No. 3 |
| Harvey E. Yates Company | | 9. Pool name or Wildcat |
| 3. Address of Operator P.O. Box 1933, Roswell, New Mexico 88202 | | TAMANO BONE SPRING |
| 4. Well Location | | |
| 4. Wen Location | | |
| Unit Letter D: 660 feet from the NORTH line and 660 feet from the WEST line | | |
| Section 5 Township 1 | 4 S Range 36 E NM | |
| 10. Elev | ation (Show whether DR, RKB, RT, GR, | etc.) |
| 3973.5' GL | | |
| 11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data | | |
| NOTICE OF INTENTION | | BSEQUENT REPORT OF: |
| PERFORM REMEDIAL WORK D PLUG AN | | DRK Image: Altering casing casing casing casing casing casing |
| TEMPORARILY ABANDON | PLANS COMMENCE D | |
| PULL OR ALTER CASING MULTIPLI | — | |
| OTHER: ADD PERFORATIONS | | |
| 12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date | | |
| of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation. | | |
| or recompnacion. | | |
| | | |
| | | |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' | ods. NU BOP. POOH w/167 stands tbg KB. Dump 35' cmt on top. RIH w/tbg | c. Close in well. / to 10,200'. Circ 10# mud. POOH w/86 |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. | KB. Dump 35' cmt on top. RIH w/tbg | to 10,200'. Circ 10# mud. POOH w/86 |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f | to 10,200'. Circ 10# mud. POOH w/86 |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work loss in the set of the set of | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. | to 10,200'. Circ 10# mud. POOH w/86 |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work log 2/12/03 Lay down a total of 185 jts. RIH & s @ 4650' POOH Close in well. | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work log 2/12/03 Lay down a total of 185 jts. RIH & s @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3 | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work log 2/12/03 Lay down a total of 185 jts. RIH & s @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3 @ 302'. POOH & spot 20 sx @ 60' to 20 st @ 60' to 20' st @ 60' st @ 6 | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag vellhead, install dry hole marker. Level |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work log 2/12/03 Lay down a total of 185 jts. RIH & s @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3 | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RII 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag wellhead, install dry hole marker. Level ed as to plugging of the Well Bore. |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work log 2/12/03 Lay down a total of 185 jts. RIH & s @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3 @ 302'. POOH & spot 20 sx @ 60' to 20 st @ 60' to 20' st @ 60' st @ 6 | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag vellhead, install dry hole marker. Level ed as to plugging of the Well Bore. under bond is retained until |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work log 2/12/03 Lay down a total of 185 jts. RIH & s @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3 @ 302'. POOH & spot 20 sx @ 60' to 20 st @ 60' to 20' st @ 60' st @ 6 | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag wellhead, install dry hole marker. Level ed as to plugging of the Well Bore. |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work log 2/12/03 Lay down a total of 185 jts. RIH & s @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3 @ 302'. POOH & spot 20 sx @ 60' th pit & cellar, cut off deadmen. Move | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag vellhead, install dry hole marker. Level ed as to plugging of the Well Bore. under bond is retained until restoration is completed, |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work log 2/12/03 Lay down a total of 185 jts. RIH & s @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3 @ 302'. POOH & spot 20 sx @ 60' to 20 st @ 60' to 20' st @ 60' st @ 6 | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag vellhead, install dry hole marker. Level ed as to plugging of the Well Bore. under bond is retained until restoration is completed, |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work log 2/12/03 Lay down a total of 185 jts. RIH & s @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3 @ 302'. POOH & spot 20 sx @ 60' to pit & cellar, cut off deadmen. Move I hereby certify that the information above is to pool. | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. - Approve and lity arface rue and complete to the best of my know | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag vellhead, install dry hole marker. Level ed as to plugging of the Well Bore. under bond is retained until restoration is completed, wledge and belief. |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work lood 2/12/03 Lay down a total of 185 jts. RIH & sig @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3: @ 302'. POOH & spot 20 sx @ 60' the pit & cellar, cut off deadmen. Move I hereby certify that the information above is the SIGNATURE Standard Standard | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. - Approve and lity arface rue and complete to the best of my know | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag wellhead, install dry hole marker. Level ed as to plugging of the Well Bore. under bond is retained until restoration is completed, wledge and belief. On Analyst DATE 11/21/02 |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work lood 2/12/03 Lay down a total of 185 jts. RIH & sg @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3 @ 302'. POOH & spot 20 sx @ 60' to pit & cellar, cut off deadmen. Move sit & cellar, cut off deadmen. Move sit & SIGNATURE Standard Sta | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. - Approve and lity arface rue and complete to the best of my know | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag vellhead, install dry hole marker. Level ed as to plugging of the Well Bore. under bond is retained until restoration is completed, wledge and belief. |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work lood 2/12/03 Lay down a total of 185 jts. RIH & sig @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3: @ 302'. POOH & spot 20 sx @ 60' the pit & cellar, cut off deadmen. Move I hereby certify that the information above is the SIGNATURE Standard Standard | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. Approve achieved a spot of the set of my know TITLE Producti | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag vellhead, install dry hole marker. Level ed as to plugging of the Well Bore. under bond is retained until restoration is completed, wledge and belief. On Analyst DATE 11/21/02 Telephone No. 505-623-6601 |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work loo 2/12/03 Lay down a total of 185 jts. RIH & s @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3: @ 302'. POOH & spot 20 sx @ 60' tu pit & cellar, cut off deadmen. Move sit & cellar, cut off deadmen. Move sit & signature for the second state state. I hereby certify that the information above is the second state second state use. | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. Approve achieved a spot of the set of my know TITLE Producti | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag vellhead, install dry hole marker. Level ed as to plugging of the Well Bore. under bond is retained until restoration is completed, wledge and belief. On Analyst DATE 11/21/02 Telephone No. 505-623-6601 |
| 2/7/03 RIH & set CIBP @ 10,300' using 15' stands. Close in well. 2/10/03 Weld on pull nipple. Rig up casing ja 2/11/03 RIH & cut casing @ 6800' - work lood 2/12/03 Lay down a total of 185 jts. RIH & sg @ 4650'. POOH. Close in well. 2/13/03 RIH & Tag @ 4538'. POOH & spot 3 @ 302'. POOH & spot 20 sx @ 60' to pit & cellar, cut off deadmen. Move sit & cellar, cut off deadmen. Move sit & SIGNATURE Standard Sta | KB. Dump 35' cmt on top. RIH w/tbg acks. Cut casing @ 6850'. Casing not f ose. Lay down 103 jts. Close in well. pot 50 sx @ 7100'. POOH. WOC. RIF 35 sx @ 2100'-2000'. POOH & spot 35 o surface. POOH & rig down. Cut off v out. - Approve and lity arface rue and complete to the best of my know | to 10,200'. Circ 10# mud. POOH w/86 ree. H & tag @ 6738'. POOH & spot 45 sx sx @ 430'. POOH & WOC. RIH & tag vellhead, install dry hole marker. Level ed as to plugging of the Well Bore. under bond is retained until restoration is completed, wledge and belief. On Analyst DATE 11/21/02 Telephone No. 505-623-6601 |

らし、