

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-25-28206
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Saunders State A
8. Well No. 1
9. Pool name or Wildcat Saunders Permo(Upper, Penn)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator Eclipse Oil & Gas, Inc.	3. Address of Operator P.O. Box 15122, Odessa, TX 79768	4. Well Location Unit Letter J : 1980 Feet From The South Line and 1980 Feet From The East Line Section 16 Township 14-S Range 33E NMPM Lea County	10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4224 GR
---	--	--	--	---

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-19-00 Set 5-1/2" CIBP @8900', tag w/ tbg. @ 8900'.
10-20-00 Circulate hole w/ mud.
10-20-00 Spot 25 sx cmt. on CIBP @ 8900'.
10-20-00 Spot 25 sx cmt. @ 7000'.
10-23-00 Cut 5-1/2" Csg. @ 3210'.
10-23-00 Spot 25 sx cmt. @ 4236', tag @ 3951'.
10-23-00 Spot 35 sx cmt. @ 3265'.
10-24-00 Tag plug @ 3080'.
10-24-00 Spot 35 sx cmt. from 1860'-1750'.
10-24-00 Spot 40 sx cmt. @ 432', tag @ 317'.
10-24-00 Spot 15 sx cmt. from 15' to Surface.

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Roger Massey TITLE Agent DATE 10/27/00
TYPE OR PRINT NAME Roger Massey TELEPHONE NO. (915) 570-7087
(This space for State Use)
APPROVED BY GARY W. WINK DATE JAN 28 2001
OC FIELD REPRESENTATIVE II/STAFF MANAGER

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.	30-25-28206
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	?
7. Lease Name or Unit Agreement Name	
Saunders State "A"	
8. Well No.	1
9. Pool name or Wildcat	Saunders Permo (Upper Penn)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator Eclipse Oil & Gas, Inc.
3. Address of Operator P.O. Box 15122 Odessa, TX 79768	4. Well Location Unit Letter J : 1980 Feet From The South Line and 1980 Feet From The East Line Section 16 Township 14S Range 33E NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4224 GR.	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

(NOTIFY COSERVATION COMMISSION (505) 393-6161 24HRS. BEFORE OPERATIONS BEGIN)

- (1) MIRU Unit, pressure up on tbg. to 500#, lay down rods, POH w/tbg.
- (2) Set CIBP on WL @ 8900' and cap w/25# cement. **DUMP BAILER OR 25SX - TAG BOTTOM PLUG**
- (3) TIH w/tbg. circ hole w/10# BW w/25# SWG per bbl., pump 25sx. plug @ 7000' POH
- (4) Stretch, cut and lay down 5 1/2" csg.
- (5) TIH w/tbg. Pump 50' in & 50' out plug across 5 1/2" stub. (TAG W/TBG.)
- (6) Pump 100' plug across 8-5/8" shoe @ 4174'. (TAG W/TBG.)
- (7) Pump 100' plug across 13-3/8" shoe @ 426'. (TAG W/TBG.)
- (8) Pump 15sx. surface plug.
- (9) Install dry hole marker.

NEED SALT PLUG F/1843+01743

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Frelan Fields TITLE Agent DATE 9/19/00
TYPE OR PRINT NAME Frelan Fields (915) 366-1852
TELEPHONE NO.

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: