	OIL CONSERVATION DIVISION	
DISTRIBUTION	P. O. BOX 2068	Frank 6, 100
SANTA FE		Form C-103 Revised 10-1-7
FILE	SANTA FE, NEW MEXICO 87501	
U.S.G.S.		5a. Indicate Type of Lease
LAND OFFICE		State X Fee
DPERATOR		5. State Oil & Gas Lease No.
		B-9385
SUNDRY 100 NOT USE THIS FORM FOR PROP USE "APPLICATIO	NOTICES AND REPORTS ON WELLS	·· ()))))))))))))))))))))))))))))))))))
OIL CAS GAS WELL	OTHER-	7. Unit Agreement Name
, Name of Operator	8. Farm or Lease Name	
Texaco Inc.	N. M. "AN" State	
Address of Operator	9. Well No.	
PO Box 728, Hobbs, New I	12	
. Location of Well		10 Field and Root of Wildow
UNIT LETTERG	1980 FEET FROM THE North LINE AND 2303	10. Fleid and Pool, or Wildom Saunders Permo Upper Penn
THE East LINE, SECTION	22 TOWNSHIP 14S 33E	<sup>ныры</sup> -
	i2. County	
	4208' GR	Lea ()))))//
Check Aj	ppropriate Box To Indicate Nature of Notice, Repo	rt or Other Data
NOTICE OF INT		EQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	COMMENCE DRILLING OPHS.	
PULL OR ALTER CABING	HANGE PLANS	PLUG AND ABANDONMENT
	OTHER	· L
0THER		

ACIDIZE PERMO PENN PERFS.

•

- MIRU pulling unit. Pull rods. Install BOP. Pull tubing.
  RIH with bit and scraper on 2 7/8" tubing to 9992' (PBTD 10,000', 8' of fill). POH.
  RIH with 5 1/2" packer on 2 7/8" tubing. Set at 9700'. Pump 70 bbls. water down casing.
  Acidize the Permo Penn perfs at 9791'-9944' with 3,000 gallons of 15% NE-FE acid containing 2 drums of Unichem's TH756 scale inhibitor and 2 drums of TW425, 100 ball sealers, and 200# of rock salt. 5.3 BPM at 1300-1500 psi.

.

•

5) Release packer. RIH with production equipment. Place well back on production.

.

APPROVED BY	ORIGINAL SIGNED BY JERRY SEXTON DISTRICT I SUPERVISOR	TITLE	"FEB 2 9 1988
BIGNED	Jakea	Hobbs Area Superintendent	DATE2/24/88
18.1 hereby	certify that the information above is true and comple	te to the best of my knowledge and belief. 397-3	571