

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-73

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

API - 30-025-28391

5a. Indicate Type of Lease	
State ☒	For ☐
5. State Oil & Gas Lease No.	
B-9560	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		7. Unit Agreement Name	
2. Name of Operator TEXACO Inc.		8. Farm or Lease Name N. M. 'BG' St. NCT-2	
3. Address of Operator P. O. Box 728, Hobbs, New Mexico 88240		9. Well No. 2	
4. Location of Well UNIT LETTER <u>H</u> <u>2310</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM <u>East</u> <u>16</u> TOWNSHIP <u>14-S</u> RANGE <u>33-E</u> NMPM.		10. Field and Pool, or Wildcat <u>Saunders Permo</u> <u>Upper Penn</u>	
15. Elevation (Show whether DF, RT, GR, etc.) <u>4213' (Gr)</u>		12. County <u>Lea</u>	

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	OTHER <u>Perforate & Complete</u> ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

TOTAL DEPTH 10,100'
PLUG BACK TOTAL DEPTH 10,090'
13 3/8" OD 48# H-40 CSG SET @ 540'
8 5/8" OD 32# J-55 CSG SET @ 4200'
5 1/2" OD 17# N-80 &K-55 CSG SET @ 10,100'

1. PERFORATE 5 1/2" CSG W/2-JSPF FROM 10,009-10,012' & 10,040'-10,050'.
2. SET RBP @ 10,070' AND PKR @ 9841'. ACIDIZE PERFS 10,009'-10,050' W/3000 GALS 15% NE ACID AND 36 BALL SEALERS.
3. PERFORATE 5 1/2" CSG W/2-JSPF FROM 9931'-9940'; 9945'-9948'; 9955'-9958'; & 9964'-9970'.
4. ACIDIZE PERFS 9931'-9970' W/5000 GALS 15% NE ACID AND 60 BALL SEALERS.
5. SET RBP @ 9910' & PKR @ 9748'. PERFORATE 5 1/2" CSG W/2-JSPF FROM 9834'-9737'; 9848'-9850'; 9856'-9858'; 9866'-9870'; 9872'-9875'; 9882'-9886' & 9891'-9893'.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J. Sexton TITLE Asst Dist Mgr DATE 4-3-84
ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR
APPROVED BY _____ TITLE _____ DATE APR 4 1984

CONDITIONS OF APPROVAL, IF ANY:

6. ACIDIZE PERFS 9834'-9893' W/5000 GALS 15% NE ACID AND 60 BALL SEALERS.
7. PULL RBP & PKR. SET BAKER MODEL D PKR W/MODEL B KNOCKOUT PLUG IN 5 1/2" CSG @ 9996' (PBTD).
8. INSTALL PUMPING EQUIPMENT. TESTED WELL AND PLACE ON PRODUCTION.