

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State ☒	For ☐
5. State Oil & Gas Lease No.	
B-9505	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER		7. Unit Agreement Name
2. Name of Operator TEXACO INC.		8. Farm or Lease Name NEW MEXICO AT ST.
3. Address of Operator P. O. BOX 728, HOBBS NEW MEXICO 88240		9. Well No. 11-Y
4. Location of Well UNIT LETTER <u>D</u> <u>990</u> FEET FROM THE <u>North</u> LINE AND <u>890</u> FEET FROM THE <u>West</u> LINE, SECTION <u>15</u> TOWNSHIP <u>14-S</u> RANGE <u>33-E</u> NMPM.		10. Field and Pool, or Wildcat SAUNDERS PERMO UPPER PERM
15. Elevation (Show whether DF, RT, GR, etc.) 4215' (GR)		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPERATIONS ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	OTHER <u>Perforate & Complete</u> ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting, any proposed work) SEE RULE 1103.

TOTAL DEPTH 10,100'
PLUG BACK TOTAL DEPTH 10,050'
13 3/8" OD 54# K-55 CSG SET @ 530'
8 5/8" OD 24# & 32# K-55 CSG SET @ 4190'
5 1/2" OD 17# N-80 & J-55 CSG SET @ 10,100'

1. PERFORATE 5 1/2" CSG W/2-JSPF FROM 9996'-10,002 AND FROM 10,018'-10,024'.
2. SET PACKER @ 9882'. ACIDIZE 5 1/2" CSG PERFS 9996'-10,024' W/2000 GALS 15% NE ACID AND 44 BALL SEALERS.
3. SQUEEZE 5 1/2" CSG PERFS 9996'-10,024' W/75 SX CLASS H CEMENT CONTAINING .6% HALAD-9.
4. PERFORATE 5 1/2" CSG W/2-JSPF FROM 9773'-9777'; 9789'-9795'; 9819'-9824'; 9837'-9841'; 9880'-9904'; 9910'-9915'; AND 9959'-9962'.
5. SET RBP @ 9980' AND PKR @ 9860'. ACIDIZE PERFS 9880'-9962' W/3100 GALS 15% NE ACID.
6. RESET PKR @ 9730'. ACIDIZE PERFS 9773'-9962' W/5400 GALS 15% NE ACID AND 175 BALL SEALERS.
7. INSTALL PUMPING EQUIPMENT. TEST AND PLACE ON PRODUCTION.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Asst Dist Mgr DATE 11-28-83

ORIGINAL SIGNED BY EDDIE SEAY

OIL & GAS INSPECTOR

APPROVED BY _____ TITLE _____ DATE NOV 30 1983

CONDITIONS OF APPROVAL, IF ANY: