

State of New Mexico
Energy, Minerals and Natural Resources Department

DISTRICT I

P.O. Box 1980, Hobbs NM 88240

DISTRICT II

P.O. Drawer DD, Artesia NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-28529
5. Indicate Type of Lease	
State	<input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	
LG-814	
7. Lease Name or Unit Agreement Name	
WOODPECKER SY STATE	
8. Well No.	8
9. Pool Name or Wildcat	
Saunders Permo Upper Penn	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
4223.4' GR	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL GAS

WELL WELL OTHER

2. Name of Operator

Yates Petroleum Corporation

3. Address of Operator

105 South 4th., Artesia, NM 88210

4. Well Location

Unit Letter **E** : **1980** Feet From The **NORTH** Line and **660** Feet From The **EAST** Line

Section **21** Township **14S** Range **33E** NMPM **LEA** COUNTY

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK PLUG AND ABANDON

TEMPORARILY ABANDON CHANGE PLANS

PULL OR ALTER CASING

OTHER

SUBSEQUENT REPORT OF:

REMEDIAL WORK ALTERING CASING

COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT

CASING TEST AND CEMENT JOB


OTHER

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

YATES PETROLEUM CORPORATION proposes to plug & abandon as follows:

- RU PU & plugging equipment. Load tubing & casing. Install BOP.
- Production record shows pump @ 8480', but no anchor reported.
- POH w/ rods, pump, & tubing.
- Set CIBP @ 9790' & cap w/ 35' of cement.
- Freepoint 5-+1/2" casing; cut & pull casing. TOC is 6916' per CBL.
- GIH w/ tubing open ended to 7786'. Load hole w/ salt gel plugging mud.
- Spot 25 sk cement plug across Abo top (7736') from 7786-7686'.
- Pull up & spot 35 sk cement plug across 5-1/2" casing stub (@ 6800'+-). Pull up WOC & tag plug at least 50' above stub. If no tag, respot plug, WOC, & tag.
- Pull up & spot 35 sk plug across the Glorieta top - 5583'.
- Pull up & spot 35 sk plug across 8-5/8" casing shoe - 4197'. WOC & tag plug @ 4147' or higher. If on tag, respot plug, WOC, & tag. → SPOT 100' PLUG F/1950'-1850' (T.O.S.)
- Pull up & spot 35 sk plug across 13-3/8" shoe depth - 460'. - TAG
- Set a 15 sk plug at the surface & install a regulation abandonment marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

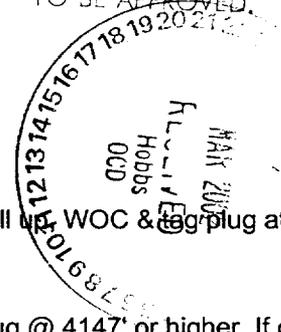

I hereby certify that the information above is a true and complete to the best of my knowledge and belief.

SIGNATURE Donna Clack TITLE Operations Technician DATE 3/26/02

TYPE OR PRINT NAME DONNA CLACK TELEPHONE NO. 505-748-1471

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE APR 02 2002

CONDITIONS OF APPROVAL, IF ANY:

ORIGINAL SIGNED BY
GARY W. WINK
OC FIELD REPRESENTATIVE / DISTRICT MANAGER

J
C