

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-025-28675

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
K-3138

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
State of NM P

1. Type of Well:
OIL WELL ☐ GAS WELL ☒ OTHER

2. Name of Operator
Louis Dreyfus Natural Gas Corporation

8. Well No. 2

3. Address of Operator
14000 Quail Springs Parkway, Ste. 600, Oklahoma City, OK

9. Pool name or Wildcat
Baum Upper Penn

4. Well Location 73134
Unit Letter N : 660 Feet From The South Line and 1980 Feet From The West Line

Section 33 Township 13S Range 33E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4244'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- (1) 7-10-01 Set 5-1/2" CIBP @ 9650', dump 4 sx cmt. 35' on top the CIBP.
- (2) 7-10-01 Circulation w/ mud gel.
- (3) 7-10-01 Spot 25 sx cmt. from 6615' to 6494'.
- (4) 7-11-01 Cut 5-1/2" casing @ 4105', spot 30 sx cmt. from 4158 to 4025', 8-5/8" shoe stub, WOC, tag @ 4017'.
- (5) 7-12-01 Spot 30 sx cmt. from 1760 to 1657'.
- (6) 7-12-01 Spot 30 sx cmt. from 505 to 402, 13-3/8" shoe, WOC, tag @ 390'.
- (7) 7-12-01 Spot 15 sx cmt. from 50' to 3' surface plug.
- (8) Cut csg, weld on plate, erect steel marker, clean location.

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Agent DATE 7-24-01

TYPE OR PRINT NAME TELEPHONE NO.

(This space for State Use)

APPROVED BY [Signature] TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE

CONDITIONS OF APPROVAL, IF ANY:

GW

JAN 1 6 2003