

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator Sun Exploration & Production Company		8. Farm or Lease Name New Mexico JJ State
3. Address of Operator P.O. Box 1861 Midland, Texas 79702		9. Well No. 3
4. Location of Well UNIT LETTER <u>A</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>800</u> FEET FROM THE <u>East</u> LINE, SECTION <u>23</u> TOWNSHIP <u>13S</u> RANGE <u>32E</u> N.M.P.M.		10. Field and Pool, or Wildcat Baum (Upper Penn)
15. Elevation (Show whether DF, RT, GR, etc.) 4309 GR		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

NOTE: DISCUSSED PROCEDURE W/ EDDY SEAY, N.M.O.C.C.
(505/393-6161) 5/25/88.

- MIRU PU. POH W/ RODS & PUMP. LD RODS & WAREHOUSE. NU BOP. RLSE TAC & POH W/ 2-7/8" TBG.
- RIH W/ 5-1/2" CIBP ON WL. SET PLUG @ ±9720'. SPOT 5 SX CMT VIA DUMP BAILER ON TOP. RIH W/TBG. DISPLACE HOLE W/ 10#/GAL MUD-LADEN FLUID. POH.
- DETERMINE FREE POINT OF PRODUCTION CSG. RIH W/ CSG CUTTER & CUT CSG @ FREE PT. POH W/ CSG LD.
- RIH W/ 2-7/8" TBG OE TO ±9660'. SPOT 100' PLUG W/ 50' BELOW THE STUB & 50' ABOVE THE STUB (±18 SX). WOC. TAG PLUG W/ TBG.
- SPOT 100' PLUG FROM ±5340' TO ±5240' (±25 SX). SPOT 100' PLUG FROM ±4050' TO ±3950' (±26 SX). WOC. TAG PLUG W/ TBG.

THE COMMISSION MUST BE NOTIFIED
24 HOURS PRIOR TO COMMENCING WORK

see back side

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Alma Franco TITLE Accounting Associate DATE 7/21/88

APPROVED BY Paul Kautz TITLE Geologist DATE AUG 01 '88
CONDITIONS OF APPROVAL, IF ANY:

NEW MEXICO JJ STATE #3
LEA COUNTY, NEW MEXICO

6. SPOT 100' PLUG FROM $\pm 2500'$ TO $\pm 2400'$ (± 26 SX). SPOT 10 SX PLUG @ SURFACE.
SPOT 100' PLUG FROM $\pm 500'$ TO $\pm 400'$
7. CUT OFF WELLHEAD 4' BGL & WELD ON STEEL PLATE. INSTALL DRY HOLE MARKER. CLN LOCATION.
RLSE RIG.