

1. MIRU Plug and Abandonment Unit. Bleed Pressure off. TOH & lay packer down.
2. Determine freepoint of 5½" casing.
3. TIH with 2 3/8" tubing to 12938'. Circulate hole with 210 bbls mud laden fluid. Spot a 20 sx Class "C" plug from 12938-12726'.
4. Pull tubing to 12140'. Spot 20 sx plug across top of Atoka from 12140'-11928'.
5. (a) If freepoint is above 9300'. Spot a 20 class "C" plug across top of Wolfcamp from 9503-9291'. TOH. Shoot casing off above freepoint. TOH and lay down casing. Continue with step 6.

(b) If freepoint is below 9300'. TOH with tubing. Shoot casing off above freepoint. TOH. Laying down casing. TIH with tubing. Spot a 35 sx class "C" across top of Wolfcamp from 9503-9366'.
6. Spot a 25 sx class "C" plug across casing stub. (50' inside and 50' outside).
7. Spot a 35 sx class "C" plug across top of Abo from 7949'-7813'.
8. Spot a 35 sx class "C" plug across 8 5/8" casing shoe from 4562-4462'.
9. Spot a 35 sx class "C" plug across base of salt section from 2950-2821'.
10. Spot a 35 sx class "C" plug across top of salt section from 2246-2117'.
11. Spot a 35 sx class "C" plug from 432'-303'
12. Spot a 10 sx class "C" plug 40' to surface.
13. Cut casing off below ground level.
14. Install a 4" pipe monument extending 4' above ground level with the following information.

Flag-Redfern Oil Company
Huber State No. 1
NW/4 SE/4 Sec. 33, T-12-S, R-35-E
15. Haul casing and tubing to yard. Level pits and clean location.

RECEIVED

FEB -1 1985

O.C.D.
HOUSING OFFICE