

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.  
30-025-29005

5. Indicate Type of Lease  
STATE  FEE

6. State Oil & Gas Lease No.  
V-721

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name  
NM "EM" STATE

1. Type of Well:  
OIL WELL  GAS WELL  OTHER

8. Well No. 1

2. Name of Operator  
JFG ENTERPRISE

3. Address of Operator  
PO BOX 100, ARTESIA, NM 88210

9. Pool name or Wildcat  
KING DEVONIAN

4. Well Location  
Unit Letter I : 1650 Feet From The SOUTH Line and 330 Feet From The EAST Line

Section 2 Township 14S Range 37E NMPM LEA County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)  
3836' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: _____ <input type="checkbox"/>		OTHER: _____ <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 11-16-93 Set Alpha CIBP @ 12,560', spot 5 sx cmt on top of CIBP.
- 11-20-93 Load hole w/MLF. Mix & pump 25 sx cmt & displace w/55 BMLF.
- 11-26-93 Cut & pull 4950' 5-1/2" casing - RIH w/160 jts. tbg. to 5007'. Mix & pump 11-29-93 40 sx cmt & displace w/28 BMLF.
- 11-30-93 RIH w/tbg. tag TOC @ 4937'. Mix & pump 35 sx cmt & displace w/28 BMLF.
- 12-02-93 RIH w/nitro cutter & cut 445' POH.
- 12-06-93 RIH w/tbg. load hole. Mix & pump 65 sx cmt and displace w/2 BMLF. RIH & tag TOC @ 297'. POH. Spot 10 sx cmt surf plug. Cut off anchors & install DH marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. T. Jackson TITLE PARTNER DATE 2-14-94  
TYPE OR PRINT NAME J.T. JACKSON TELEPHONE NO. 746-9680

(This space for State Use)

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE APR 25 1994  
CONDITIONS OF APPROVAL, IF ANY: