

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. NM V-124

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO OCEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT - 1" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator MWJ PRODUCING COMPANY	8. Farm or Lease Name BAUM 17 STATE
3. Address of Operator 400 W. Illinois - Suite 1100 Midland, Texas 79701	9. Well No. 2
4. Location of Well UNIT LETTER <u>H</u> <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>17</u> TOWNSHIP <u>14S</u> RANGE <u>33E</u> NMPM.	10. Field and Pool, or Wildcat Baum Upper Penn
15. Elevation (Show whether DF, RT, GR, etc.) 4235' GL	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11/25/87: Plugged and abandoned well as follows:
Set CIBP @ 9800' w/10 sx cmt & 10# mud.
Cut off 5-1/2" csg @ 6000', pulled total of 142 jts.
Spt'd 60 sx cmt plug from 6059-5950' w/10# mud. PD @ 6: PM 11/23/87. WOC.
Tagged plug @ 5923'
Spt'd 70 sx cmt plug from 4165-4065' w/10# mud. WOC 3 hrs.
RU W/L & tagged plug @ 4080'.
Spt'd 40 sx cmt plug from 1600-1700'.
Spt'd 10 sx cmt plug from 30' to surface.
WELDED ON DRY HOLE MARKER 11/25/87.

I, I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Pat Drexler TITLE Pat Drexler - Agent DATE 11/25/87

PROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE OCT 24 1987

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
NOV 30 1987
OCD
HOBBS OFFICE