

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION

P. O. BOX 2083
SANTA FE, NEW MEXICO 87501

Form C-101
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANT/FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State <input type="checkbox"/> Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐

1. Name of Operator Gary L. Bennett	7. Unit Agreement Name
2. Address of Operator P.O. Box 16844 Lubbock, TX 79490	8. Name of Lease Pearl Western
3. Location of Well UNIT LETTER L 1980 FEET FROM THE South LINE AND 610 FEET FROM THE West LINE, SECTION 18 TOWNSHIP 12 S RANGE 38 E N.M.P.M.	9. Well No. 1-Y
10. Field and Pool, or Acreage Gladiola Wolfcamp	11. County Lea
15. Elevation (Show whether DF, RT, GR, etc.) 3887.6 DF	

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Swab Test Well - No show of Oil - Begin Plugging operations.

- 5/31/88 - Rig up Permian Basin Casing Pullers. Set CIBP @ 9350', placed a 45' cement plug (5 sx) on top of CIBP. Displace hole with drilling mud.
- 6/1/88 - Shoot casing @ 5218'- no recovery, shoot casing @ 4436'. Recovered 4436' 5 1/2" J-55, 17#, LBC. Circulate remaing hole with drilling mud. Spot 20 sx cement plug @ 5250'. Spot 50 sx cement plug @ 4490'.
- 6/2/88 - Tag top of shoe plug @ 4360'. Spot 40 sx cement plug @ 1000' inside 8 5/8" casing. Place 10 sx cement plug @ surface. Rig down pulling unit. Install Dry Hole Marker as per State recommendations.

OCD Inspector - Jack Griffin

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Michael S. Mooney</u>	TITLE <u>Engineer</u>	DATE <u>6/3/88</u>
APPROVED BY <u>Jack Griffin</u>	TITLE <u>OIL & GAS INSPECTOR</u>	DATE <u>JUL 13 1988</u>
CONDITIONS OF APPROVAL, IF ANY:		