

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-29421
5. Indicate Type of Lease	STATE ☐ FEE ☒
6. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE 'APPLICATION FOR PERMIT' (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
OXY USA Inc.

3. Address of Operator
P.O. Box 50250 Midland, TX. 79710

4. Well Location
Unit Letter L : 1650 Feet From The South Line and 990 Feet From The West Line
Section 25 Township 13S Range 34E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4110.5'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- * Notify NMOC at start of plugging operations. Procedure verbally approved by Paul Kautz.
- 1. Set CIBP on wireline @ 9450'. Dump 4 sx cmt on top. RIH w/ OE tbq to 9410'. ND BOP. NU WH. RD PU.
- 2. MIRU plugging unit. Circ hole w/ mud laden fluid. POOH w/ tbq. ND csg head & weld on pick-up sub. RU wireline. Find free pt & cut csg. POOH w/ 5-1/2" csg. NU BOP.
- 3. RIH w/ OE tbq & set 100' cmt plug across csg stub (50' in / 50' out), approx 25 sx. WOC. Tag Plug.
- 4. Set 100' cmt plug 5800-5700' (top of Glorieta 5801'), approx 35 sx. POOH to 4350'. Set 100' cmt plug across csg shoe (50' in / 50' out), approx 35 sx. WOC. Tag plug.
- 5. Set 100' cmt plug 1950-1850 (top of anyhdrite 1950'), approx 35 sx. Set 10 sx surface plug. ND BOP. Cut wellhead. Install surface marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE David Stewart TITLE Production Accountant DATE 5/8/91

TYPE OR PRINT NAME David Stewart TELEPHONE NO. 915-685-571

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: