

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.
V-1881

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO OPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT - (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator J. Cleo Thompson	8. Farm or Lease Name State 36
3. Address of Operator 4500 First Republic Tower II Dallas; Texas 75201	9. Well No. 1
4. Location of well UNIT LETTER I 1980' south 660' EAST 36 13s 32e THE LINE, SECTION TOWNSHIP RANGE N.M.P.M.	10. Field and Pool, or Wildcat Buam upper penn
11. Elevation (Show whether DF, RT, GR, etc.) 4292 G.L.	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

On 7-21-89 plugging procedures were started.
Beginning with pulling rods and standing the tubing back.
1. C.I.B.P. @ 9650' w/35' cmt. and tag.
2. 25 sx. class c cmt. @ 9100' wolf camp
3. 25 sx. " " " " @ 7500' abo
4. 25 sx. " " " " @ 6850' and tag @ 6303' (tubb)
5. 25 sx. " " " " @ 5400' gloriotta
6. Went in hole w/ 5½ test pkr. set @ 3630' tested below to 1000# for 10 minutes OK. Tried to unseat pkr. but couldnt. Sheared out and came out of hole. No Pkr. Welded on and tagged pkr. @ 3631' shot csg. @ 3606! Csg. did not come loose. Stretched for free point indicated @ 2080' and shot it @ 2084' and came out of hole laying csg. down.
7. 25 sx. @ 3785'
8. 50 sx. @ 2130' and tag
9. 40 sx. @ 400'
10. 10 sx. @ surface
11. Cut csg. below ground level and weld on P&A marker.
(Capped 5½ test pkr. w/ 25sx. cmt.)

P&A 7-27-89

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Amadeo P. L. TITLE Production Foreman DATE 8-1-89

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE DEC 27 1989

CONDITIONS OF APPROVAL, IF ANY: