

Attachment I

Item 17 (Continued)

10. Pull up to $\pm 5310'$. Set 100 sx balanced cmt plug across the Glorieta from 5310'-5150'. Pull up to 5150' and reverse clean.
11. Pull up to 4050'. Set 60 sx balanced plug across 9 5/8" csg shoe from 4050'-3950'. Pull up to 3940' and reverse clean.
12. Pull up to $\pm 1580'$. Set 50 sx balanced plug across top of salt section from 1580'-1480'. Pull up to 1470' and reverse clean. POOH.
13. RIH to $\pm 50'$. Set 25 sack surface plug. POOH. Rd cementers. RD plugging unit.
14. Cut off csg 5' below ground level. Weld on csg cap. Restore surface location.