

Plugging Report

D & J Oil Co

Lowe 27 #1

Lea County, New Mexico

Job #1951

6-28-96 Friday

On location @ 1:00. MIRU.

RT: 1:00-4:00 3.0 hrs

7-1-96 Monday

On location @ 9:00. Blew down tbg and csg. ND wellhead and NU BOP. RU and POOH w/ tbg and packer. RIH w/ CIBP and set @ 11775'. POOH w/ wireline. Started in hole w/ tbg. SISD.

RT: 7:30-9:00 13.5 hrs CRT: 16.5 hrs

7-2-96 Tuesday

On location @ 6:30. Finished RIH w/ tbg to 11775'. RU. Circulated hole w/ mud and pumped 25 sx C cmt up to 11528'. POOH w/ tbg to 8200'. Filled hole and pumped 25 sx C cmt up to 7955'. POOH w/ tbg. RIH w/ wireline and ran CBL. POOH w/ wireline. RIH w/ wireline and cut csg @ 6095'. POOH w/ wireline. SISD.

RT: 6:30-4:00 9.5 hrs CRT: 26.0 hrs

7-3-96 Wednesday

On location @ 7:00. Opened up well. Removed BOP and unflanged wellhead. PU 5-1/2" csg spear and latched onto 5-1/2" csg, pulled 110k points. Rig began to sink. Released spear and POOH w/ spear. Flanged up well and installed BOP. RIH w/ tbg. RD and installed steel mat. RU. POOH w/ tbg. SISD.

RT: 6:30-1:30 7.0 hrs CRT: 33.0 hrs

7-8-96 Monday

On location @ 8:00. ND wellhead. Speared into csg, free. RU and POOH w/ 147 jts of csg. RD csg tools. Contacted Bonny w/ OCD @ 2:49 PM. NU BOP and RIH w/ tbg to 6145'. Filled hole and pumped 45 sx C cmt. POOH w/ tbg and WOC. SISD.

RT: 7:00-6:30 11.5 hrs CRT: 44.5 hrs

7-9-96 Tuesday

On location @ 7:00. RIH w/ tbg and tagged plug @ 6045'. POOH w/ tbg to 4475'. Circulated hole w/ mud and pumped 45 sx C cmt. POOH w/ tbg to 1850'. WOC 3.0 hrs. RIH w/ wireline and tagged plug @ 4268'. POOH w/ wireline. Filled hole and pumped 45 sx C cmt from 1850' to 1674'. POOH w/ tbg. ND BOP and wellhead. RIH w/ tbg to 32' and pumped 10 sx C cmt to surface. POOH. RD.

RT: 6:00- CRT: