

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-34280
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. va1172
7. Lease Name or Unit Agreement Name: Aspen "27" State
8. Well No. 1
9. Pool name or Wildcat Tres Papalitos

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other
2. Name of Operator Aspen Exploration, Inc.
3. Address of Operator 508 W. Wall Suite 700, Midland, TX 79701
4. Well Location Unit Letter N : 660 feet from the South line and 2130 feet from the West line Section 27 Township 14-S Range 34-E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)


11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Pull pkr @ 12,425'. Load hole w/salt gel @ 905#/gal. POH w/2 2/8" tbq.
2. Set CIBP @12,400' w/35' cmt top.
3. Pulled 9,000' 5 1/2" casing.
4. Spot 40 sx plug @9,062' - 8,885'. Tagged.
5. Spot 40 sx plug @6,260' - 6,130'. Tagged.
6. Spot 35 sx plug @2,090 - 1,990'.
7. Spot 35 sx plug @489' - 349'. Tagged.
8. Spot 20 sx plug @Surface.
9. Cut off welhead and anchors. Installed dry hole marker. Level pit and cellar. Move off.

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

NOTE: See attached

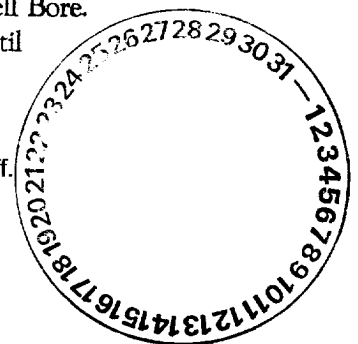

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. W. Mulloy TITLE Agent DATE 2/22/02
Type or print name J. W. Mulloy Telephone No. (915) 687-0323
(This space for State use)

APPROVED BY GARY W. WINK
Conditions of approval, if any OC FIELD REPRESENTATIVE II/STAFF MANAGER

JAN 16 2003

GW

MAYO MARRS CASING PULLING INC.

ASPEN EXPLORATION, INC.

Lease: ASPEN "27" STATE # 1
Project: P & A

FAX 915-686-7224

01-13-02

NOTIFY OCD - MOVE TO LOCATION

1-14-02

RIG UP - NDWH - NUBOP - WORK PACKER LOOSE - STAND BACK 188 STANDS -
CLOSE IN WELL

1-15-02

WIRELINE TRUCK HAVING NEW LINE INSTALLED - SHOULD HAVE BEEN READY - WILL
CALL WHEN BACK ONLOCATION

1-16-02

RIH & SET CIBP @ 12,400' - DUMP 5 SXS CEMENT ON TOP - RIH WITH TUBING & CIR. 10#
MUD - POOH WITH 36 STANDS - CLOSE IN WELL

1-17-02

LOAD HOLE WITH MUD - POOH - NDWH - WELD ON PULL NIPPLE -

1-18-02

RIG UP CASING JACKS - CUT CASING @ FREEPOINT 9000' - LAY DOWN 7 JOINTS

1-21-02

LAYING DOWN CASING

1-22-02

LAYING DOWN CASING

1-23-02


LAY DOWN CASING - RIH WITH TUBING & SPOT 40 SXS @ 9062' - POOH - CLOSE IN WELL

1-24-02

RIH WITH TUBING & TAG @ 8885' - POOH & SPOT 40 SXS @ 6260' - POOH - WDC - RIH &
TAG @ 6130' - POOH & SPOT 35 SXS @ 2090' - POOH & SPOT 35 SXS @ 489' - POOH

1-25-02

RIH & TAG @ 349' - POOH & SPOT 20 SXS @ 60' TO SURFACE - RIG DOWN - CUT OFF
WELLHEAD AND ANCHORS - INSTALL DRY HOLE MARKER - LEVEL PIT & CELLAR
MOVE OUT

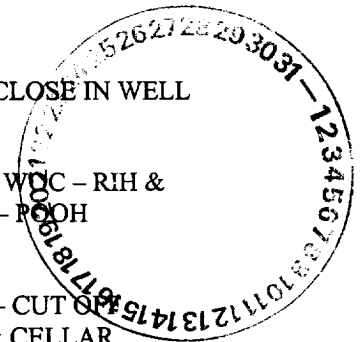

MAYO MARRS CASING PULLING INC.
BOX 863
KERMIT, TEXAS 79745

ASPEN EXPLORATION, INC.

Lease: ASPEN "27" STATE # 1
Project: P & A – CEMENTING REPORT

01-16-2002 – SET CIBP @ 12,400' – DUMP 35' CEMENT ON TOP
PULLED 9000' OF 5 ½" CASING
01-23-2002 – SPOT 40 SXS @ 9062' - 8885' TAGGED
01-24-2002 - SPOT 40 SXS @ 6260' - 6130' TAGGED
01-24-2002 - SPOT 35 SXS @ 2090' - 1990'
01-24-2002 - SPOT 35 SXS @ 489' - 349' TAGGED
01-25-2002 - SPOT 20 SXS @ 60' - SURFACE

INSTALL DRY HOLE MARKER
CIRCULATE 10# MUD

