

OIL CONSERVATION DIVISION

DISTRICT I
1625 N. French Dr., Hobbs, NM 88240
DISTRICT II
811 S. First, Artesia, NM 88210
DISTRICT III
1000 Rio Brazos Rd, Aztec, NM 87410
DISTRICT IV
2040 South Pacheco, Santa Fe, NM 87505

2040 S. Pacheco
Santa Fe, New Mexico 87505

WELL API NO.
30-025-34526
5. Indicate Type of Lease
STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name
Tower
8. Well No.
1
9. Pool name or wildcat
HIGHTOWER; ABO GAS

 
SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL or TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well:	OIL <input type="checkbox"/>	GAS <input checked="" type="checkbox"/>	WELL	OTHER
2. Name of Operator	C. W. TRAINER			
3. Address of Operator	c/o OIL REPORTS & GAS SERVICES, INC., 1008 W. BROADWAY, HOBBS, NM 88240			
4. Well Location	Unit Letter N : 373 Feet From The SOUTH Line and ***** Feet From The WEST Line			
Section 23	Township 12S	Range 33E	NMPM LEA	County
10. Elevation (Show whether DF, RKB, RT, GR, ect)				
4244'				

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG & ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST & CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: ADD ADDT'L PERF'S <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MIRU. SET CIBP @ 8398'. PERF 8217', 8224', 8234', 8244', 8250', 8252', 8261', 8268', 8278', 8302', 8306', 8312', 8318', 8324', 8330', 8334', 8337', 8340', 8346', 8350', 8353', 8354', 8356', 8358', 8365', 8368', 8372', & 8376' W/1 SHOT PER INTERVAL W/42" ENTRY HOLE & 28 GR. CHARGE. CIRC. KCL WTR & SPOT 5200 GALS 20% NEFE ACID + 75 RCN 1.3 SP GR BALL SEALERS ACROSS PERFS. SET PKR @8396' & TEST CIBP @ 8398' TO 1000#, HELD OK. SET RBP @ 8395'. MOVE PKR & SET @ 8168'. RELEASE PKR & RBP. POH W/TBG. MU SANDLINE DRL & GIH. SPUD ON CIBP @ 8398' & KNOCK LOOSE, CHASE DOWN HOLE TO 8530'. DO BP W/SAND PUMP. SET TBG TO 8550'. SWAB TO REMOVE ALL FLUID. RIG DOWN & PLACE WELL BACK ON PRODUCTION.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.			
SIGNATURE		TITLE	AGENT
DATE		02/08/2001	
TYPE OR PRINT NAME	Gaye Heard	TELEPHONE NO.	(505) 393-2727
(THIS SPACE FOR STATE USE)			
APPROVED BY	TITLE	DATE	
CONDITIONS APPROVAL, IF ANY:			