

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-161) FOR SUCH PROPOSALS.)

1. OIL <input type="checkbox"/> GAS <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator Amoco Production Company		8. Farm or Lease Name Swearingen B
3. Address of Operator P. O. Box 68, Hobbs, NM 88240		9. Well No. 1
4. Location of Well UNIT LETTER <u>F</u> <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM <u>West</u> <u>20</u> TOWNSHIP <u>5-S</u> RANGE <u>33-E</u> NMPM.		10. Field and Pool, or Wildcat Und. Yeso
15. Elevation (Show whether DF, RT, GR, etc.) 4417' RDB		12. County Roosevelt

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Moved in service unit 8-29-83. Pulled tubing. Set a cast iron bridge plug at 7720'. Displaced hole with mud and capped cast iron bridge plug with 100' cement. Welded on pull nipple and installed casing jacks. Ran freepoint and casing showed to be free 3000' from surface. Cemented casing 3019' from surface. Pulled casing. Spotted 15 sacks cement at 4256'. Spotted 50 sacks cement at 3059'. Spotted 55 sacks cement at 1974' and spotted 10 sacks cement at surface. Erected dry hole marker and moved out service unit 9-3-83.

O+5-NMOCD,H 1-R.E.Ogden, Hou Rm 21.150 1-F.J. Nash,HOU Rm 4.206 1-CLF

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Cathy L. Forman</u>	TITLE <u>Asst. Adm. Analyst</u>	DATE <u>10-12-83</u>
Orig. Signed by <u>Paul Kautz</u>		
APPROVED BY <u>Paul Kautz</u>	TITLE <u>Geologist</u>	DATE <u>12/28/83</u>
CONDITIONS OF APPROVAL, IF ANY:		