

Submit to Office
in appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1930, Hobbs, NM 88240

DISTRICT II
P.O. Drawer 80, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-041-20716

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name

Miller "10"

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
Bledsoe Petro Corp

8. Well No.
#1

3. Address of Operator
3908 N. Peniel, Syite 500, Bethany, OK 73008

9. Pool name or Wildcat
South Peterson *Fessenden*

4. Well Location
Unit Letter G : 1980 Feet From The North Line and 1650 Feet From The East Line

Section 10 Township 6S Range 33E NMPM Roosevelt County

10. Elevation (Show whether LF, RKB, RT, GR, etc.)
4390.2 GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2/9/94 MIRU - Set CIBP @ 4000'. Dumped 4 sx cement on plug.
2/10/94 Bond log well - Found well had been squeezed. TOC 1685'. GIH w/workstring to 3960'.
2/11/94 Circulate hole w/mud. Pull tubing to 3250. Pump 25 sx CL A cement. POH w/tubing.
2/14/94 Weld on pull nipple. Cut csg. @ 1655 and lay down.
2/15/94 GIH w/tbg. to 1700'. Pump 45 sx CL A cement. WOC 4 hrs. Tag at 1495'. Pull tbg. to 475'. Pump 35 sx CL A cement. Pulled tbg to 60'. Pump 20 sx CL A cement. Rig down. Cut well head off. Weld cap on surface casing. Install plugged well marker. Clean location for abandonment.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Chris Ball

TITLE

Agent

DATE

5/4/94

TYPE OR PRINT NAME

Chris Ball

TELEPHONE NO.

817-629-8563

(This space for State Use)

APPROVED BY

Jack Griffin

TITLE

DATE

JUN 03 1994

CONDITIONS OF APPROVAL, IF ANY: