

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1920, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Hrazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.

30-041-20722

5. Indicate Type of Lease

STATE ☐

FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Federal 9

8. Well No.

1

9. Pool name or Wildcat

Undesignated Silurian

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL  
WELL ☐

GAS  
WELL ☐

OTHER SWD

2. Name of Operator

Bledsoe Partners, Inc.

3. Address of Operator

3908 N. Peniel, Suite 500, Bethany, OK 73008

4. Well Location

Unit Letter E : 1980 Feet From The North Line and 660 Feet From The West Line

Section 9 Township 6S Range 34E NMPM Roosevelt County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

4367 GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4/28/94 MIRU - Release Packer. POH w/tbg.  
4/29/94 Set CIBP @ 7840'. Dump 5 sx cement on top of plug. GIH w/tbg. to 7775'. SDFN.  
5/2/94 Circulate hole with mud-pull tbg. to 5840 and pump 25 sx Cl A Cement. Pull tbg. to 3840' and pump 25 sx Cl A cement. POH w/tbg. SDFN.  
5/3/94 Tear down well head. Weld on pull nipple. Cut csg @ 3250'. Lay down csg. SDFN.  
5/4/94 GIH w/tbg to 3300'. Pump 45 sx Cl A cement. WOC 4 hrs. Tag plug @ 3109'. Pull tbg to 2015'. Pump 45 sx Cl A cement. Woc 4 hrs. Tag @ 1778'. Pull tbg. to 30'. Pump 10 sx Cl A cement. Cut wellhead off. Weld cap on surface csg. Install plugged well marker. Clean location for abandonment.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

*Chris Ball*

TITLE Agent

DATE 5/4/94

TYPE OR PRINT NAME

Chris Ball

TELEPHONE NO. 817-629-8563

(This space for State Use)

APPROVED BY

*Jack Griffin*

OIL & GAS INSPECTOR

AUG 25 1995

CONDITIONS OF APPROVAL, IF ANY:

FOR RECORD ONLY

RECEIVED

MAY 05 1994

HOODS  
OFFICE