

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

JIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-79

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- P&A	7. Unit Agreement Name
2. Name of Operator Yates Petroleum Corporation	8. Farm or Lease Name Howard XY
3. Address of Operator 105 South 4th St., Artesia, NM 88210	9. Well No. 3
4. Location of Well UNIT LETTER L, 1650 FEET FROM THE South LINE AND 330 FEET FROM THE West LINE, SECTION 17 TOWNSHIP 7S RANGE 32E NMPM.	10. Field and Pool, or WHdcat Tomahawk SA
15. Elevation (Show whether DF, RT, GR, etc.) 4460' GR	12. County Roosevelt

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged well as follows:

Set CIBP at 3930'. Mix mud and load hole. Circulate oil out of hole.
Spot 35' cement on top of of CIBP.
Spot 25 sx cement plug at 3413'.
Cut 4-1/2" casing at 2300' and pull.
Spot 35 sx cement plug with 3% CaCl2 at 2350'. Tagged plug at 2218'.
Spot 35 sx cement plug at 1926'.
Spot 35 sx cement plug at 1730'. Tagged plug at 1606'.
Mixed mud and circulated. hole.
Install 10 sx cement surface plug.
Weld on dry hole marker.

Note: Heavy mud between plugs..
Plugging completed 4-7-87.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Luanta Goodlett</u>	TITLE <u>Production Supervisor</u>	DATE <u>4-8-87</u>
APPROVED BY <u>Jack Griffin</u>	TITLE <u>OIL & GAS INSPECTOR</u>	DATE <u>JAN 04 1988</u>
CONDITIONS OF APPROVAL, IF ANY:		