

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. <b>30-041-20786</b>	
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>	
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name  <b>Boys Ranch</b>	
8. Well No. <b>#1</b>	
9. Pool name or Wildcat <b>South Peterson Penn Assoc.</b>	

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL  
WELL ☒

GAS  
WELL ☐

OTHER

2. Name of Operator

**Bledsoe Petro Corp**

3. Address of Operator

**3908 N. Peniel, Bethany, Oklahoma 73008**

4. Well Location

Unit Letter **K** : **1980** Feet From The **South** Line and **1980** Feet From The **West** Line

Section **17** Township **6S** Range **34E** NMPM **Roosevelt** County

10. Elevation (Show whether DP, RKB, RT, GR, etc.)

**4370 GR**

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4/18/94 MIRU - Kill well -POH w/tbg. SDFN.

4/19/94 Set CIBP @ 7594. Dump bail 5 sx cement on top of plug. GIH w/tbg. to 7500' and circulate mud. P.O.H. w/tbg. Tear down wellhead. SDFN.

4/20/94 Weld on pull nipple. Rig up casing jacks. Ran bond log. Found well had been squeezed @ 2300'. Call OCD in Hobbs for new procedures. Cut off pull nipple and ran tbg to 5200.

4/21/94 Pump 25 sx CL A cement @ 5200'. POH w/tbg. Weld on pull nipple. Cut csg. @ 2000' POH w/csg. GIH w/tbg to 2050. Pump 40 sx CL A cement. Pull 15 stands tbg. SDFN.

4/22/94 Tag Plug @ 1830'. Pull tbg to 30'. Pump 10 sx. Cut off well head. Weld cap on surface csg. Install plugged weld marker. Clean loc. for abandonment.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

*Chris Ball*

TITLE

*Agent*

DATE

*5/4/94*

TYPE OR PRINT NAME

**Chris Ball**

TELEPHONE NO. **817-629-8563**

(This space for State Use)

APPROVED BY

*Billy E. Prueber*

TITLE

*Oil & Gas Division*

DATE

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

MAY 31 1994

JOHN HODDS  
OFFICE