Ĩ.	. <b>.</b>	and the second sec
		P. O. CO.4 1030 HOBBS, NEW MEXICO 96240
	MARCEIVED	FORM APPROVED Budget Burget No. 1004-0135
BUREAU OF LAND MANAGEMENT		Expres March 31, 1993 5. Lesse Designation and Senai No.
	STIFINISELLS 56 PH '96	NM 0315712
Do not use this form for proposals to drill or to deepe Use "APPLICATION FOR PERMIT"	in or reentry to a different reservoir.	6, if Indian, Allotte or Tribe Name
	BURFeleine The Standard	
SUBMIT IN TRIPLE ATE	NH HOBDS, IM	7. If Unit or CA, Agreement Designation
Name of Operator		Maljamar Grayburg Unit
The Wiser Oil Company Address and Telephone No.		8. Well Name and No. 22
		9. Weil API No.
		30-25-00457
207 W. McKay, Carlsbad, NM 88220 885-5433 Location of Wet (Footage, Sec., T., R., M., or Survey Description)		10. Field and Pool, or Exploratory Area Malianmar, Crawburg, San, Andrea
. Lucasuri ur vres (Forage, Sec., J., R., M., of Savey Description)		Maljamar Grayburg San Andres 11. County or Parish, State
990' FWL & 1980' FSL, Unit L, Section 4-T17S-	UnitL	Lea County, NM
12 CHECK APPROPRIATE BOX(S) TO INI	DICATE NATURE OF NOTICE, RE	PORT, OR OTHER DATA
TYPE OF SUBMISSION	TYF	PE OF ACTION
Notice of Intent	X Abandonment	Change of Plans
X Subsequent Report	Plugging Back	Non-Routine Fracturing
	Casing Repair	Water Shut-Off
Final Abandonment Notice	Altering Casing	Conversion to Injection
	Other	Dispose Water
		(Note Report results of multiple complesion on Well
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent date	s incluting estimated data of starting any proposed w	Completion or Recompletion Report and Log form )
subsurface locations and measured and true vertical depths for all markers and zones perti	• • • •	
·	inent to this zone.)*	AREA I
subsurface locations and measured and true vertical depths for all markers and zones perti Work performed to Plug & Abandon the above captioned well 01/0	inent to this zone.)*	NG - m
subsurface locations and measured and true vertical depths for all markers and zones perti Work performed to Plug & Abandon the above captioned well 01/0 1. POOH with 2 1/16" tubing & 3 1/2" packer.	inent to this zone.)*	A HEA
subsurface locations and measured and true vertical depths for all markers and zones perti Work performed to Plug & Abandon the above captioned well 01/0	inent to this zone.)* 18/96 - 01/12/96 as follows:	I II US
<ul> <li>subsurface locations and measured and true vertical depths for all markers and zones perti Work performed to Plug &amp; Abandon the above captioned well 01/0</li> <li>1. POOH with 2 1/16" tubing &amp; 3 1/2" packer.</li> <li>2. RIH with bit &amp; scraper to 3900'.</li> </ul>	inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release.	I II US
<ul> <li>subsurface locations and measured and true vertical depths for all markers and zones pertil.</li> <li>Work performed to Plug &amp; Abandon the above captioned well 01/0</li> <li>1. POOH with 2 1/16" tubing &amp; 3 1/2" packer.</li> <li>2. RIH with bit &amp; scraper to 3900'.</li> <li>3. Set 3 1/2" cement retainer @ 3768'. Setting tool &amp; collar locator well 01/0</li> </ul>	inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release. vithout snueezing perfs.	I II US MM
<ul> <li>subsurface locations and measured and true vertical depths for all markers and zones pertil.</li> <li>Work performed to Plug &amp; Abandon the above captioned well 01/0</li> <li>1. POOH with 2 1/16" tubing &amp; 3 1/2" packer.</li> <li>2. RIH with bit &amp; scraper to 3900'.</li> <li>3. Set 3 1/2" cement retainer @ 3768'. Setting tool &amp; collar locator with</li> <li>4. Unable to fish wireline tools. Obtained BLM approval to plug well with</li> </ul>	inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release. vithout snueezing perfs.	I II 49
<ul> <li>Subsurface locations and measured and true vertical depths for all markers and zones pertil.</li> <li>Work performed to Plug &amp; Abandon the above captioned well 01/0</li> <li>POOH with 2 1/16" tubing &amp; 3 1/2" packer.</li> <li>RIH with bit &amp; scraper to 3900'.</li> <li>Set 3 1/2" cement retainer @ 3768'. Setting tool &amp; collar locator with</li> <li>Unable to fish wireline tools. Obtained BLM approval to plug well with</li> <li>RIH with 2 1/16" tubing open ended &amp; set 75 sx cement plug from</li> <li>Set 11 sx plug from 1200' - 1000'. POOH with tubing.</li> <li>Perforate 3 holes at 400' through 3 1/2" casing &amp; 5 1/2" casing. Br</li> </ul>	inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release. vithout snueezing perfs. 3768' - 800'. reak circulation between 5 1/2" casing & 8	A HEADQUARTERS
<ul> <li>subsurface locations and measured and true vertical depths for all markers and zones pertil.</li> <li>Work performed to Plug &amp; Abandon the above captioned well 01/0</li> <li>POOH with 2 1/16" tubing &amp; 3 1/2" packer.</li> <li>RIH with bit &amp; scraper to 3900'.</li> <li>Set 3 1/2" cement retainer @ 3768'. Setting tool &amp; collar locator with</li> <li>Unable to fish wireline tools. Obtained BLM approval to plug well with</li> <li>RIH with 2 1/16" tubing open ended &amp; set 75 sx cement plug from</li> <li>Set 11 sx plug from 1200' - 1000'. POOH with tubing.</li> <li>Perforate 3 holes at 400' through 3 1/2" casing &amp; 5 1/2" casing. Brid Cement with 80 sx. Circulate around perforated 5 1/2" casing at 400</li> </ul>	inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release. vithout snueezing perfs. 3768' - 800'. reak circulation between 5 1/2" casing & 8	A HEADQUARTERS
<ul> <li>subsurface locations and measured and true vertical depths for all markers and zones pertil.</li> <li>Work performed to Plug &amp; Abandon the above captioned well 01/0</li> <li>POOH with 2 1/16" tubing &amp; 3 1/2" packer.</li> <li>RIH with bit &amp; scraper to 3900'.</li> <li>Set 3 1/2" cement retainer @ 3768'. Setting tool &amp; collar locator with</li> <li>Unable to fish wireline tools. Obtained BLM approval to plug well with</li> <li>RIH with 2 1/16" tubing open ended &amp; set 75 sx cement plug from</li> <li>Set 11 sx plug from 1200' - 1000'. POOH with tubing.</li> <li>Perforate 3 holes at 400' through 3 1/2" casing &amp; 5 1/2" casing. Br</li> </ul>	inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release. vithout snueezing perfs. 3768' - 800'. reak circulation between 5 1/2" casing & 8	A HEADQUARTERS
<ul> <li>subsurface locations and measured and true vertical depths for all markers and zones pertil.</li> <li>Work performed to Plug &amp; Abandon the above captioned well 01/0</li> <li>1. POOH with 2 1/16" tubing &amp; 3 1/2" packer.</li> <li>2. RIH with bit &amp; scraper to 3900'.</li> <li>3. Set 3 1/2" cement retainer @ 3768'. Setting tool &amp; collar locator with</li> <li>Unable to fish wireline tools. Obtained BLM approval to plug well with</li> <li>5. RIH with 2 1/16" tubing open ended &amp; set 75 sx cement plug from</li> <li>6. Set 11 sx plug from 1200' - 1000'. POOH with tubing.</li> <li>7. Perforate 3 holes at 400' through 3 1/2" casing &amp; 5 1/2" casing. Brichernet with 80 sx. Circulate around perforated 5 1/2" casing at 400</li> </ul>	inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release. vithout snueezing perfs. 3768' - 800'. reak circulation between 5 1/2" casing & 8	A HEADQUARTERS
<ul> <li>subsurface locations and measured and true vertical depths for all markers and zones pertil.</li> <li>Work performed to Plug &amp; Abandon the above captioned well 01/0</li> <li>1. POOH with 2 1/16" tubing &amp; 3 1/2" packer.</li> <li>2. RIH with bit &amp; scraper to 3900'.</li> <li>3. Set 3 1/2" cement retainer @ 3768'. Setting tool &amp; collar locator with</li> <li>4. Unable to fish wireline tools. Obtained BLM approval to plug well with</li> <li>5. RIH with 2 1/16" tubing open ended &amp; set 75 sx cement plug from</li> <li>6. Set 11 sx plug from 1200' - 1000'. POOH with tubing.</li> <li>7. Perforate 3 holes at 400' through 3 1/2" casing &amp; 5 1/2" casing at 40.</li> <li>8. Rig down. Clean location &amp; install dry hole marker.</li> </ul>	inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release. vithout snueezing perfs. 3768' - 800'. reak circulation between 5 1/2" casing & 8	5/8" casing. ng full of cement.
<ul> <li>subsurface locations and measured and true vertical depths for all markers and zones pertil.</li> <li>Work performed to Plug &amp; Abandon the above captioned well 01/0</li> <li>POOH with 2 1/16" tubing &amp; 3 1/2" packer.</li> <li>RIH with bit &amp; scraper to 3900'.</li> <li>Set 3 1/2" cement retainer @ 3768'. Setting tool &amp; collar locator with</li> <li>Unable to fish wireline tools. Obtained BLM approval to plug well with</li> <li>RIH with 2 1/16" tubing open ended &amp; set 75 sx cement plug from</li> <li>Set 11 sx plug from 1200' - 1000'. POOH with tubing.</li> <li>Perforate 3 holes at 400' through 3 1/2" casing &amp; 5 1/2" casing. Brit Cement with 80 sx. Circulate around perforated 5 1/2" casing at 40</li> <li>Rig down. Clean location &amp; install dry hole marker.</li> </ul>	inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release. vithout snueezing perfs. 3768' - 800'. reak circulation between 5 1/2" casing & 8	5/8" casing. ng full of cement.
subsurface locations and measured and true vertical depths for all markers and zones pertive         Work performed to Plug & Abandon the above captioned well 01/0         1. POOH with 2 1/16" tubing & 3 1/2" packer.         2. RIH with bit & scraper to 3900'.         3. Set 3 1/2" cement retainer @ 3768'. Setting tool & collar locator with         4. Unable to fish wireline tools. Obtained BLM approval to plug well with         5. RIH with 2 1/16" tubing open ended & set 75 sx cement plug from         6. Set 11 sx plug from 1200' - 1000'. POOH with tubing.         7. Perforate 3 holes at 400' through 3 1/2" casing & 5 1/2" casing. Br         Cement with 80 sx. Circulate around perforated 5 1/2" casing at 40         8. Rig down. Clean location & install dry hole marker.         4. I hereby certify that the forepoing is true and correct         signed       Image: Correct use         worroved By       The space for redena. or state office use	inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release. without snueezing perfs. 3768' - 800'. reak circulation between 5 1/2" casing & 8 00'. Circulate 10 sx to pit. Left 3 1/2" casin the Agact	5/8" casing. ng full of cement.
subsurface locations and measured and true vertical depths for all markers and zones pertil.         Work performed to Plug & Abandon the above captioned well 01/0         1. POOH with 2 1/16" tubing & 3 1/2" packer.         2. RIH with bit & scraper to 3900'.         3. Set 3 1/2" cement retainer @ 3768'. Setting tool & collar locator with         4. Unable to fish wireline tools. Obtained BLM approval to plug well with         5. RIH with 2 1/16" tubing open ended & set 75 sx cement plug from         6. Set 11 sx plug from 1200' - 1000'. POOH with tubing.         7. Perforate 3 holes at 400' through 3 1/2" casing & 5 1/2" casing. Br         Cement with 80 sx. Circulate around perforated 5 1/2" casing at 40         8. Rig down. Clean location & install dry hole marker.         4. I hereby certify that the forepoing is true and correct         signed         Maximum Adduct         Maximum Adduct         wis SPACE FOR FEDERAL OR STATE OFFICE USE1         pproved By	Inert to this zone.)* 18/96 - 01/12/96 as follows: 10/112/96 as fo	5/8" casing. 1/29/96 Date $1/29/96$ RS Pairs Duc well Done. A robust of the set o
Subsurface locations and measured and true vertical depths for all markers and zones pertive Work performed to Plug & Abandon the above captioned well 01/0  1. POOH with 2 1/16" tubing & 3 1/2" packer. 2. RIH with bit & scraper to 3900'. 3. Set 3 1/2" cement retainer @ 3768'. Setting tool & collar locator we 4. Unable to fish wireline tools. Obtained BLM approval to plug well we 5. RIH with 2 1/16" tubing open ended & set 75 sx cement plug from 6. Set 11 sx plug from 1200' - 1000'. POOH with tubing. 7. Perforate 3 holes at 400' through 3 1/2" casing & 5 1/2" casing. Br Cement with 80 sx. Circulate around perforated 5 1/2" casing at 40 8. Rig down. Clean location & install dry hole marker. 4. I hereby certify that the foregoing is true and correct ingred poroved By conditions of approval, if any:  the 18 U. S. C. Section 1001, makes # a crime for any person knowingly and wilfully to make any department	Inert to this zone.)* IB/96 - 01/12/96 as follows: IB/96 - 01/12/96 as follows: ID/01/12/96 as follows	5/8" casing. In 1/29/96 Date 1/29/96 Sine 3/18/96 RS Date 3/18/96 RS Date 000000000000000000000000000000000000
Subsurface locations and measured and true vertical depths for all markers and zones pertively work performed to Plug & Abandon the above captioned well 01/0  1. POOH with 2 1/16" tubing & 3 1/2" packer. 2. RIH with bit & scraper to 3900'. 3. Set 3 1/2" cement retainer @ 3768'. Setting tool & collar locator with 4. Unable to fish wireline tools. Obtained BLM approval to plug well with 5. RIH with 2 1/16" tubing open ended & set 75 sx cement plug from 6. Set 11 sx plug from 1200' - 1000'. POOH with tubing. 7. Perforate 3 holes at 400' through 3 1/2" casing & 5 1/2" casing. Bit Cement with 80 sx. Circulate around perforated 5 1/2" casing at 40 8. Rig down. Clean location & install dry hole marker. 4. I hereby certify that the forgooing is true and correct His SPACE FOR FEDERAL OR STATE OFFICE USE1  porroved By  the 18 U. S. C. Section 1001, makes it a crime for any person knowingly and wilfully to make any department to any matter within its unsidetion.	Inert to this zone.)* IB/96 - 01/12/96 as follows: IB/96 - 01/12/96 as follows: ID/01/12/96 as follows	5/8" casing. In 1/29/96 Date 1/29/96 Sine 3/18/96 RS Date 3/18/96 RS Date 000000000000000000000000000000000000
Subsurface locations and measured and true vertical depths for all markers and zones pertively work performed to Plug & Abandon the above captioned well 01/0  1. POOH with 2 1/16" tubing & 3 1/2" packer. 2. RIH with bit & scraper to 3900'. 3. Set 3 1/2" cement retainer @ 3768'. Setting tool & collar locator with 4. Unable to fish wireline tools. Obtained BLM approval to plug well with 5. RIH with 2 1/16" tubing open ended & set 75 sx cement plug from 6. Set 11 sx plug from 1200' - 1000'. POOH with tubing. 7. Perforate 3 holes at 400' through 3 1/2" casing & 5 1/2" casing. Bit Cement with 80 sx. Circulate around perforated 5 1/2" casing at 40 8. Rig down. Clean location & install dry hole marker. 4. I hereby certify that the forgooing is true and correct His SPACE FOR FEDERAL OR STATE OFFICE USE1  porroved By  the 18 U. S. C. Section 1001, makes it a crime for any person knowingly and wilfully to make any department to any matter within its unsidetion.	Inert to this zone.)* 18/96 - 01/12/96 as follows: ould not release. without snueezing perfs. 3768' - 800'. reak circulation between 5 1/2" casing & 8 00'. Circulate 10 sx to pit. Left 3 1/2" casin the Agent the	5/8" casing. In 1/29/96 Date 1/29/96 Sine 3/18/96 RS Date 3/18/96 RS Date 000000000000000000000000000000000000