

UNIT STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE  
(Other instructions on reverse side)

Form approved.  
Budget Bureau No. 42-R1424.  
1. LEASE DESIGNATION AND SERIAL NO.

NM-080258

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR  
TEXACO Inc.

3. ADDRESS OF OPERATOR  
P.O. Box 728 Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)  
At surface 1650' FSL & 660' FEL of Section 15,  
T-17-S, R-32-E, Unit Letter, Lea County, New Mexico

14. PERMIT NO.  
Regular

15. ELEVATIONS (Show whether DF, RT, GR, etc.)  
4033' (DF)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME  
Federal USA 'C'

9. WELL NO.  
2

10. FIELD AND POOL, OR WILDCAT  
Maljamar Grayburg  
Grayburg San Andres

11. SEC., T., R., or B.L. AND SURVEY OR AREA  
Sec 15, T-17-S, R-32-E

12. COUNTY OR PARISH  
Lea

13. STATE  
NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☒

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETION ☐

ABANDON\* ☐

CHANGE PLANS ☐

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT\* ☐

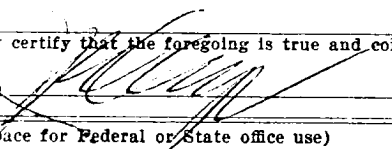
(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Please cancell 9-330, Approval 5-18-77, covering acid job on Well #1. Proper well should have been No. 2. The following work will be done on #2.

1. Rig up. Install BOP. Pull production equipment.
2. Clean out to 4150' (TD).
3. Set RBP @ 4125' & pkr. @ 4000'. Acidize perforations 4064'-4108' w/3000 gal 15% NE Acid in 3-1000 gal stages using 500# rock salt between stages. Flush w/treated fresh water.
4. Reset RBP @ 4000' & pkr @ 3850'. Acidize perforations 3903'-3946' w/3000 gal 15% NE Acid in 3-1000 gal stages using 500# rock salt between stages. Flush w/treated fresh water.
5. Pull RBP and pkr swab.
6. Install pumping equipment. Test and return to production.

18. I hereby certify that the foregoing is true and correct

SIGNED 

TITLE Asst. Dist. Supt.

DATE 8-12-77

(This space for Federal or State office use)

APPROVED BY  
CONDITIONS OF APPROVAL, IF ANY:

TITLE

**APPROVED**

DATE AUG 15 1977

BERNARD MOROZ  
ACTING DISTRICT ENGINEER

\*See Instructions on Reverse Side