

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

LC-029405B

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

MCA Unit No. 15

9. API Well No.

30-025-00586

10. Field and Pool, or Exploratory Area

Matjaman (G-SA)

11. County or Parish, State

Lea, NM

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well

☐ Gas Well

☒ Other

Injection

2. Name of Operator

Conoco Inc.

3. Address and Telephone No.

10 Delta Dr. - Midland, TX 79705

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660 FSL & 1980 FWL

Unit letter N, Sect. 17, T17S, R32E

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

2-22-91 Pull pkr out, run bit & scraper to 3540, pull out, run pkr in hole to 3540, set, tst csg. to 1000#, pmp down tbg into open hole, pull pkr back out, run cmt ret to 3530, set ret, pmp 106 sks cmt, sting out of ret, spot 17 sks cmt on ret from 3530 to 3431, circ mud, pull tbg up to 1925, spot 17 sks cmt from 1925 to 1825, pull tbg out of hole, SD.

2-25-91 Perf well at 840, run tbg in hole to 920, circ mud down 7" up 8 5/8", spot 40 sks cmt from 920 to 742 inside & outside 7" cog, wait for plug to set up, tag plug at 742, lay tbg down, perf well at 145, circ well, pmp 45 sks cmt down 7" out 8 5/8", shut well in.

2-26-91 Check cmt, fill to top, cut off wellhead, install marker, RD.

Plug & abandon 2-26-91

14. I hereby certify that the foregoing is true and correct

Signed

Christine Neff

for

Analyst - Oil Production

Date

4-15-91

(This space for Federal or State office use)

Approved by

Title

Date

6-6-91

Conditions of approval, if any: