Form 3160-5	UNITED STA		
(June 1990)	DEPARTMENT OF THE	INTERIOR 1980	Budget Bureau No. 1004-0135
	BUREAU OF LAND MA	NAGEMENT	
		NAGEMENT NA 88241	5. Lease Designation and Serial No.
	CUNDRY NOTIOFO AND DE		LC 058698A
<b>•</b> • • • • •	SUNDRY NOTICES AND REP		6. If Indian, Allottee or Tribe Name
	proposals to drill or to deepen or reen TION FOR PERMIT* for such propo		
	SUBMIT IN TRIPLIC		7. If Unit or CA Agreement Designation
1. Type of Well			
X Ott Gas Gas Well	INJECTION Other		
2 Name of Operator			MCA Unit
CONOCO, INC.			Well #81
3 Address and Telephone No.		· · · · · · · · · · · · · · · · · · ·	
10 Desta Dr., Suite 100W	, Midland, Texas 79705-4500,915 686-542	24 915 684-6381	30 025 00657 10. Field and Pool, or Exploratory Area
4 Location of Well (Footage, Sec	, T., R., M., or Survey Description)		Maljamar Grayburg San Andres
Surface: 660' FSL & TD: Sec 23, TI7			11 County or Parish, State
TD. Sec 23, 11/	S, R32E, Unit Letter O		Lea, NM
		ATURE OF NOTICE, REPORT, OI	R OTHER DATA
Notice of Inte	ent	X Abandonment	Change of Plans
X Subsequent Rep		Recompletion	New Construction
	Report	Plugging Back	Non-Routine Fracturing
Final Abandonm	s		Water Shut-Off
	nment Notice	Altering Casing	Conversion to Injection
			Dispose Water
			Note: Report results of multiple completion on Well
directionally drilled, give su 2-23-98: 1 2-24-98: ( 2-25-98: 1	Move in, hold safety meeting, rig f Circulate mud, spot I0 sx on CIBP cut 4 I/2", lay down 5I jts, SION. Pull 43 jts of 4 I/2", run tubing in h		work)* Ig CIBP @ 3820', SION. point 4 I/2'' casing @ 3000'
directionally drilled, give su 2-23-98: ( 2-24-98: ( 2-25-98: ( 2-26-98: (	Move in, hold safety meeting, rig ( Circulate mud, spot I0 sx on CIBP cut 4 I/2", lay down 5I jts, SION. Pull 43 jts of 4 I/2", run tubing in h Circulate mud, spot 25 sx @ 3050 tubing, perforate @ I225 and II0	al depths for all markers and zones pertinent to this v p, put on BOP, ran work string, ta from 3820-3670', pull tubing, free hole, SION. D-2900', pull tubing to 2200', spot 2 0', could not pump into perforations @ 550', circulate I30 sx down 7" to	Completion of Recompletion Report and Log form.) (starting any proposed work. If well is work.)* In CIBP @ 3820', SION. point 4 I/2" casing @ 3000' 5 sx from 2200-2050', pull s, run tubing to I275', spot
directionally drilled, give su 2-23-98: ( 2-24-98: ( 2-25-98: ( 2-26-98: (	Move in, hold safety meeting, rig is Circulate mud, spot I0 sx on CIBP cut 4 I/2", lay down 5I jts, SION. Pull 43 jts of 4 I/2", run tubing in h Circulate mud, spot 25 sx @ 3050 tubing, perforate @ I225 and II0 50 sx from I275'-975', perforate SION.	al depths for all markers and zones pertinent to this v p, put on BOP, ran work string, ta from 3820-3670', pull tubing, free hole, SION. D-2900', pull tubing to 2200', spot 2 0', could not pump into perforations @ 550', circulate I30 sx down 7" to g down, move off.	Completion of Recompletion Report and Log form.) (starting any proposed work. If well is work.)* In CIBP @ 3820', SION. point 4 I/2'' casing @ 3000' 5 sx from 2200-2050', pull s, run tubing to I275', spot
directionally drilled, give su 2-23-98: ( 2-24-98: ( 2-26-98: ( 2-27-98: (	Absurface locations and measured and true vertica Move in, hold safety meeting, rig is Circulate mud, spot I0 sx on CIBF cut 4 I/2", lay down 5I jts, SION. Pull 43 jts of 4 I/2", run tubing in h Circulate mud, spot 25 sx @ 3050 tubing, perforate @ I225 and II0 50 sx from I275'-975', perforate SION. Cut off wellhead, put in marker, rig Class "C" Cement. Mud - 25 lbs	al depths for all markers and zones pertinent to this v p, put on BOP, ran work string, ta from 3820-3670', pull tubing, free hole, SION. D-2900', pull tubing to 2200', spot 2 0', could not pump into perforations @ 550', circulate I30 sx down 7" to g down, move off.	Completion of Recompletion Report and Log form.) (starting any proposed work. If well is work.)* In CIBP @ 3820', SION. point 4 I/2'' casing @ 3000' 5 sx from 2200-2050', pull s, run tubing to I275', spot
directionally drilled, give su 2-23-98: ( 2-24-98: ( 2-25-98: ( 2-26-98: ( 2-27-98: ( 14. Thereby certify that the fore for Signed	Ann E. R Move in, hold safety meeting, rig f Circulate mud, spot I0 sx on CIBF cut 4 I/2", lay down 5I jts, SION. Pull 43 jts of 4 I/2", run tubing in h Circulate mud, spot 25 sx @ 3050 tubing, perforate @ I225 and II0 50 sx from I275'-975', perforate SION. Cut off wellhead, put in marker, rig Class "C" Cement. Mud - 25 Ibs Mud - 25 Ibs	al depths for all markers and zones pertinent to this v up, put on BOP, ran work string, ta 7 from 3820-3670', pull tubing, free hole, SION. D-2900', pull tubing to 2200', spot 2 0', could not pump into perforations @ 550', circulate I30 sx down 7" to g down, move off. salt gel per bbl.	Completion of Recompletion Report and Log form.) (starting any proposed work. If well is work.)* In CIBP @ 3820', SION. point 4 I/2" casing @ 3000' 5 sx from 2200-2050', pull s, run tubing to I275', spot
directionally drilled, give su 2-23-98: ( 2-24-98: ( 2-25-98: ( 2-26-98: ( 2-27-98: (	Ann E. R Move us, hold safety meeting, rig to Circulate mud, spot I0 sx on CIBP cut 4 I/2", lay down 5I jts, SION. Pull 43 jts of 4 I/2", run tubing in h Circulate mud, spot 25 sx @ 3050 tubing, perforate @ 1225 and II0 50 sx from 1275'-975', perforate SION. Cut off wellhead, put in marker, rig Class "C" Cement. Mud - 25 lbs rig is tyle and correct Monte R Monte R Cut office use;	al depths for all markers and zones pertinent to this v up, put on BOP, ran work string, ta proference of the string of the stri	Completion of Recompletion Report and Log form.) (starting any proposed work. If well is work.)* and CIBP @ 3820', SION. point 4 I/2" casing @ 3000' 5 sx from 2200-2050', pull s, run tubing to I275', spot 550' up 8 5/8" to surface
directionally drilled, give su 2-23-98: [ 2-24-98: ( 2-25-98: ( 2-26-98: ( 2-27-98: ( 2-27-98: ( 14. Thereby certify that the fore for Signed (This space for Federal or State Approvement of approval, if any Title 18 U S C Section 1001, make	Ann E. R Move in, hold safety meeting, rig is Circulate mud, spot I0 sx on CIBP cut 4 I/2", lay down 5I jts, SION. Pull 43 jts of 4 I/2", run tubing in h Circulate mud, spot 25 sx @ 3050 tubing, perforate @ 1225 and II0 50 sx from 1275'-975', perforate SION. Cut off wellhead, put in marker, rig Class "C" Cement. Mud - 25 Ibs Man E. R REGUL roffice use) DAVID R. GLASS Title	al depths for all markers and zones pertinent to this v up, put on BOP, ran work string, ta 7 from 3820-3670', pull tubing, free hole, SION. D-2900', pull tubing to 2200', spot 2 0', could not pump into perforations @ 550', circulate I30 sx down 7" to g down, move off. salt gel per bbl.	Completion of Recompletion Report and Log form.)  (starting any proposed work. If well is work.)*  ag CIBP @ 3820', SION. point 4 I/2" casing @ 3000'  5 sx from 2200-2050', pull s, run tubing to I275', spot 550' up 8 5/8" to surface  Date 4-20-98  Date 4-20-98
directionally drilled, give su 2-23-98: ( 2-24-98: ( 2-25-98: ( 2-26-98: ( 2-27-98: ( 2-27-98: ( 14 Thereby certify that the fore for Signed (This space for Federal or State Approved FIG. SGD.) Conditions of approval, if any This 18 U S C Section 1001, make tatements or representations as to	Ann E. R Move is the and correct Move in, hold safety meeting, rig is Circulate mud, spot I0 sx on CIBP cut 4 I/2", lay down 5I jts, SION. Pull 43 jts of 4 I/2", run tubing in h Circulate mud, spot 25 sx @ 3050 tubing, perforate @ 1225 and II0 50 sx from 1275'-975', perforate SION. Cut off wellhead, put in marker, rig Class "C" Cement. Mud - 25 lbs Man E. R REGUL Trite REGUL to office use; DAVID R. GLASS Trite	al depths for all markers and zones pertinent to this v up, put on BOP, ran work string, ta 7 from 3820-3670', pull tubing, free hole, SION. D-2900', pull tubing to 2200', spot 2 0', could not pump into perforations @ 550', circulate I30 sx down 7" to g down, move off. salt gel per bbl.	Completion of Recompletion Report and Log form.)  (starting any proposed work. If well is work.)*  ag CIBP @ 3820', SION. point 4 I/2" casing @ 3000'  5 sx from 2200-2050', pull s, run tubing to I275', spot 550' up 8 5/8" to surface  Date 4-20-98  Date 4-20-98
directionally drilled, give su 2-23-98: ( 2-24-98: ( 2-25-98: ( 2-26-98: ( 2-27-98: ( 2-27-98: ( 14. Thereby certify that the fore for Signed (This space for Federal or State Approved FIG. SGD.) Conditions of approval, if any	Ann E. R Move in, hold safety meeting, rig to Circulate mud, spot I0 sx on CIBP cut 4 1/2", lay down 5l jts, SION. Pull 43 jts of 4 1/2", run tubing in h Circulate mud, spot 25 sx @ 3050 tubing, perforate @ 1225 and II0 50 sx from 1275'-975', perforate SION. Cut off wellhead, put in marker, rig Class "C" Cement. Mud - 25 lbs Class "C" Cement. Mud - 25 lbs Man E. R Trite REGUL roffice use) DAVID R. GLASS Trite Si t a crime for any person knowingly and willfully o any matter within its jurisdiction *See Ins	al depths for all markers and zones pertinent to this v up, put on BOP, ran work string, ta p from 3820-3670', pull tubing, free hole, SION. D-2900', pull tubing to 2200', spot 2 0', could not pump into perforations @ 550', circulate 130 sx down 7" to g down, move off. salt gel per bbl. to make to any department or agency of the United struction on Reverse Side	Completion of Recompletion Report and Log form.)  Starting any proposed work. If well is work.)*  ag CIBP @ 3820', SION. point 4 I/2" casing @ 3000'  5 sx from 2200-2050', pull s, run tubing to I275', spot 550' up 8 5/8" to surface  Date 4-20-98  Date 4-20-98  States any false, fictitious or fraudulent
directionally drilled, give su 2-23-98: [ 2-24-98: ( 2-25-98: [ 2-26-98: ( 2-27-98: ( 2-27-98: ( 4. Thereby certify that the fore for Signed (This space for Federal or State Approved RIG. SGD.) Conditions of approval, if any rite 18 U S C. Section 1001, make tatements or representations as to	Ann E. R Move in, hold safety meeting, rig to Circulate mud, spot I0 sx on CIBF cut 4 1/2", lay down 5l jts, SION. Pull 43 jts of 4 1/2", run tubing in h Circulate mud, spot 25 sx @ 3050 tubing, perforate @ 1225 and II0 50 sx from 1275'-975', perforate SION. Cut off wellhead, put in marker, rig Class "C" Cement. Mud - 25 lbs Class "C" Cement. Mud - 25 lbs Mann E. R Trite REGUL roffice use) DAVID R. GLASS Trite Provide the second s	al depths for all markers and zones pertinent to this v up, put on BOP, ran work string, ta 7 from 3820-3670', pull tubing, free hole, SION. D-2900', pull tubing to 2200', spot 2 0', could not pump into perforations @ 550', circulate I30 sx down 7" to g down, move off. salt gel per bbl. to make to any department or agency of the United	Completion of Recompletion Report and Log form.)  Starting any proposed work. If well is work.)*  ag CIBP @ 3820', SION. point 4 I/2" casing @ 3000'  5 sx from 2200-2050', pull s, run tubing to I275', spot 550' up 8 5/8" to surface  Date 4-20-98  Date 4-20-98  States any false, fictitious or fraudulent

.