

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPPLICATE
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐ <u>temp. shut-in</u>	5. LEASE DESIGNATION AND SERIAL NO. <u>LC-057210(B)</u>
2. NAME OF OPERATOR <u>CONOCO INC.</u>	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR <u>P. O. Box 460, Hobbs, N.M. 88240</u>	7. UNIT AGREEMENT NAME <u>MCA</u>
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface <u>Unit M</u>	8. FARM OR LEASE NAME <u>MCA Unit</u>
14. PERMIT NO. <u>30-025-00749</u>	9. WELL NO. <u>210</u>
15. ELEVATIONS (Show whether DF, RT, GR, etc.) <u>660' FSL & 660' FWL</u>	10. FIELD AND POOL, OR WILDCAT <u>Malamar G/SA</u>
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA <u>Sec. 28-17S-32E</u>
	12. COUNTY OR PARISH <u>Lea</u>
	13. STATE <u>NM</u>

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐ Plug and Abandon

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

- ① MIRU on 10/22/85
- ② Pumped 140 bbls 10# brine to kill well
- ③ Pmp'd 2 cubic yards sand down to tbg; Set cmt retainer @ 3340'
- ④ Sqz'd csq & open hole section 3340'-3760' w/ 50 sxs class "C" neat
- ⑤ Stung out of retainer & spotted 25 sxs class "C" neat on top of retainer
- ⑥ Shot 2 holes @ 2200' & 800'; Set cmt retainer @ 2130'
- ⑦ Pumped 175 sxs class "C" neat cmt below retainer, stung out of ret and spotted 25 sxs on top of ret.
- ⑧ Set retainer @ 700'; pmp'd 175 sxs class "C" neat cmt below ret.; spotted 25 sxs on top of retainer
- ⑨ Spotted 25 sxs class "C" from 250' to surface. Rolled wellhead off and erected abandonment marker. Rigged down and cleaned location on 10/24/85.

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature]

TITLE Administrative Supervisor

DATE 12-30-85

(This space for Federal or State office use)

APPROVED BY [Signature]
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

9-9-86

*See Instructions on Reverse Side

gm