' Submit 3 Copies to Appropriate Energ District Office	State of New Me y, Minerals and Natural Re			Form C-103 Revised 1-1-89
OIL CONSERVATION DIVISION P.O. Box 1980, Hobbs, NM 88240 P.O. Box 2088 Santa Fe, New Mexico, 87504-2088		WELL API NO. 30-025-0] 5. Indicate Type of Le		
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410			6. State Oil & Gas Les E-2118	STATE XX FEE
SUNDRY NOTICES AND REPORTS ON WELLS ( DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			7. Lease Name or Unit	Agreement Name
I. Type of Well: OIL GAS WELL WELL	OTHER		State "G"	propende 004691
2. Name of Operator	n 00121		8. Well No.	50-120
Charles B. Gillespie, Jr. 004136 3. Address of Operator 9. Pool name of			9. Pool name or Wildo	33   20
			Saunders F	Permo-Penn
4. Well Location				
Unit Letter $J : 1980$ Feet Section 3 Tow	enshin 15-S Rai	aee 33-E	) Feet From The NMPM Lea	East Line
	10. Elevation (Show whether 1 4189 ' GR, 4202			
11. Check Approp NOTICE OF INTENTION	priate Box to Indicate N ON TO:		Report, or Other Da SEQUENT REF	
		REMEDIAL WORK	X AL	
			_	
TEMPORARILY ABANDON		COMMENCE DRILLIN	GOPNS. DPLU	
TEMPORARILY ABANDON		COMMENCE DRILLIN CASING TEST AND C		
PULL OR ALTER CASING	[]	CASING TEST AND C OTHER: Cut and	EMENT JOB	sing X
PULL OR ALTER CASING OTHER:  12. Describe Proposed or Completed Operations (Clework) SEE RULE 1103. 11/19/80: Cut off and pulled 11/20/80-12/5/80: Jarred and 2 1/2 jts. 12/6/80: Ran casing swedge, to mill casing, cou 12/10/80: Cut off and pulled 12/13/80-12/24/80: Milled and	arty state all perimens details, and a 2 3/8" tubing from a milled on 2 3/8" 2 3/8" tubing. " could not get through ald not get below a 5 1/2" casing from asing to 6064'. a 5 1/2" casing from a swedged 5 1/2" of a sing to 6064'.	CASING TEST AND C OTHER: <u>Cut and</u> d give perimens dates, inde om 5935'. tubing to 597 Top of tubing to ough collapsed 5955'. om 5913'. casing to 6000 om 6045'. " casing stub.	EMENT JOB pull 5 1/2" ca wing estimated date of star 4'. Ran oversh now at 6008'. casing at 5949 '. Ran wash pi Unable to get	ning any proposed not, recovered '. Attempted .pe, washed over
PULL OR ALTER CASING OTHER:  12. Describe Proposed or Completed Operations (Clework) SEE RULE 1103. 11/19/80: Cut off and pulled 11/20/80-12/5/80: Jarred and 2 1/2 jts. 12/6/80: Ran casing swedge, to mill casing, cou 12/10/80: Cut off and pulled 12/13/80-12/24/80: Milled an 5 1/2" ca 12/29/80: Cut off and pulled 12/30/80-1/10/81: Milled jun 1/12/81: Laid down tools and	arty state all periment details, and a milled on 2 3/8" 2 3/8" tubing from a milled on 2 3/8" 2 3/8" tubing. " could not get throw ald not get below " a 5 1/2" casing from asing to 6064'. a 5 1/2" casing from a swedged 5 1/2" of a sing to 6064'. a 5 1/2" casing from a for the for the for the form a form of the form of the form a form of the form of the form a form of the form of the form of the form a form of the form of the form of the form a form of the form of the form of the form of the form a form of the form of the form of the form of the form a form of the	CASING TEST AND C OTHER: <u>Cut</u> and d give perinent dates, indi- com 5935'. tubing to 597 Top of tubing to ough collapsed 5955'. com 5913'. casing to 6000 com 6045'. " casing stub. well up, riggen	EMENT JOB pull 5 1/2" ca wing estimated date of star 4'. Ran oversh now at 6008'. casing at 5949 '. Ran wash pi Unable to get	ning any proposed not, recovered '. Attempted .pe, washed over
PULL OR ALTER CASING OTHER:  12. Describe Proposed or Completed Operations (Cle work) SEE RULE 1103. 11/19/80: Cut off and pulled 11/20/80-12/5/80: Jarred and 2 1/2 jts. 12/6/80: Ran casing swedge, to mill casing, cou 12/10/80: Cut off and pulled 12/13/80-12/24/80: Milled an 5 1/2" ca 12/29/80: Cut off and pulled 12/30/80-1/10/81: Milled jun	arty state all periment details, and a 2 3/8" tubing from a milled on 2 3/8" 2 3/8" tubing. " could not get throw ald not get below a 5 1/2" casing from asing to 6064'. a 5 1/2" casing from asing to 6064'. a 5 1/2" casing from asing to 6064'. a 5 1/2" casing from a 6 1/2"	CASING TEST AND C OTHER: <u>Cut and</u> d give periment dates, inde om 5935'. tubing to 5974 Top of tubing to ough collapsed 5955'. om 5913'. casing to 6000 om 6045'. " casing stub. well up, riggen	EMENT JOB pull 5 1/2" ca wing estimated date of star 4'. Ran oversh now at 6008'. casing at 5949 '. Ran wash pi Unable to get	ning any proposed not, recovered . Attempted . pe, washed over below 6049'. DATE
PULL OR ALTER CASING OTHER: 12. Describe Proposed or Completed Operations (Cle work) SEE RULE 1103. 11/19/80: Cut off and pulled 11/20/80-12/5/80: Jarred and 2 1/2 jts. 12/6/80: Ran casing swedge, to mill casing, cou 12/10/80: Cut off and pulled 12/13/80-12/24/80: Milled an 5 1/2" ca 12/29/80: Cut off and pulled 12/30/80-1/10/81: Milled jun 1/12/81: Laid down tools and I hereby certify that the information above is the and comp	arty state all persinent details, and a milled on 2 3/8" 2 3/8" tubing from 2 3/8" tubing. " could not get throw ald not get below the d 5 1/2" casing from asing to 6064'. A 5 1/2" casing from the on top of 5 1/2" a tubing, flanged to base to the best of my too bodge and milled to the bodge an	CASING TEST AND C OTHER: <u>Cut and</u> d give periment dates, inde om 5935'. tubing to 5974 Top of tubing to ough collapsed 5955'. om 5913'. casing to 6000 om 6045'. " casing stub. well up, riggen	EMENT JOB pull 5 1/2" ca wing estimated date of star 4'. Ran oversh now at 6008'. casing at 5949 '. Ran wash pi Unable to get d down.	ning any proposed not, recovered '. Attempted pe, washed over below 6049'.