Submit 3 Copies to Appropriate District Office	State of New Mexico Etsets, Minerals and Natural Resources D	eparument	Form C-103 Revised 1-1-89	
DISTRICT I P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVATION DIVISION P.O. Box 2088		Well API NO. 30-025-01237	
DISTRICT II P.O. Drawer DD, Artesia, NM 88210 DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410		66	5. Indicate Type of Lease	
		6. State Oil & Gas Lease No.		
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		7. Lease Name or Unit Agreement Name		
. Type of Well: Ol GAS				
WELL WELL] one tryection		State 'M' Com	
Name of Operator	io la		8. Well No. 5	
Charles B. Gillesp Address of Operator	1 C , UT.		9. Pool name or Wildcat	
•	Midland, Texas 79702		Saunders Permo Upper Penn	
	10. Elevation (Show whether DF, RKB, RT 420] DF Appropriate Box to Indicate Nature of ITENTION TO: PLUG AND ABANDON REMEDIA	Notice, R SUB		
		IL WORK	ALTERING CASING	
		ice drilling		
Importantly Abandon Important of the second sec	CHANGE PLANS COMMEN CASING OTHER: Tations (Clearly state all pertinent details, and give pertin	NCE DRILLING TEST AND CE	B OPNS. PLUG AND ABANDONMENT X EMENT JOB	
<pre>IMPORARILY ABANDON ULL OR ALTER CASING ULL OR ALTER CASING UHER: 2. Describe Proposed or Completed Ope work) SEE RULE 1103. 5/14/91: Tagged ca Mixed and 5/16/91: Cut off a 5/20/91: Mixed and at 6018'. 5/22/91: Set 8 5/8 5/23/91: Tagged p1 5/24/91: Cut off a 710' acro 5/25/91: Tagged p1 5/29/91: Tagged p1 5/20/91: Tagged p1 5/30/91: Tagged p1</pre>	CHANGE PLANS COMMEN CASING OTHER: TRAJICOLS (Clearly state all periment details, and give perim st iron bridge plug at 9630'. pumped 25 SX cement at 7700'. nd pulled 5 1/2" casing at 607 pumped 25 SX cement at 6123' " cast iron bridge plug at 417 ug at 4175'. Mixed and pumped nd pulled 8 5/8" casing from 6 ss 8 5/8" casing stub. ug at 597'. Mixed and pumped ug at 316'. Mixed and pumped ug at 201'. Mixed and pumped	ACE DRILLING TEST AND CE ent dates, inclu Mixed 1 3'. across 5 5'. 25 SX ce 75 SX ce 75 SX ce 10 SX ce	BOPNS. PLUG AND ABANDONMENT X EMENT JOB ding estimated date of starting any proposed 0 ppg mud and displaced hole. 1/2" casing stub. Tagged plug ement at 4175'. xed and pumped 30 SX cement at ment at 308'. ment at 316'.	
IMPORARILY ABANDON JLL OR ALTER CASING JLL OR ALTER CASING IHER: 2. Describe Proposed or Completed Openwork) SEE RULE 1103. 5/14/91: Tagged ca Mixed and 5/16/91: Cut off a 5/20/91: Mixed and at 6018'. 5/22/91: Set 8 5/8 5/23/91: Tagged p1 5/24/91: Cut off a 710' acro 5/25/91: Tagged p1 5/20/91: Tagged p1 5/20/91: Tagged p1 5/20/91: Tagged p1 5/30/91: Tagged p1 5/30/91: Tagged p1 marker to	CHANGE PLANS COMMEN CASING OTHER: Tations (Clearly state all periment details, and give perim st iron bridge plug at 9630'. pumped 25 SX cement at 7700'. nd pulled 5 1/2" casing at 607 pumped 25 SX cement at 6123' " cast iron bridge plug at 417 ug at 4175'. Mixed and pumped nd pulled 8 5/8" casing from 6 ss 8 5/8" casing stub. ug at 597'. Mixed and pumped ug at 316'. Mixed and pumped	ACE DRILLING TEST AND CE ent dates, inclu Mixed 1 '3'. across 5 '5'. 25 SX cc 75 SX ce 75 SX ce 10 SX ce in.	BOPNS. PLUG AND ABANDONMENT X EMENT JOB	

5	<u>_</u>	J	
\mathcal{A}	a	k i	

 $\int \mathcal{E}$

e