

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.

30.025.01295

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

E-881

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL

☒

GAS
WELL

☐

OTHER

2. Name of Operator

PENROC OIL CORPORATION

3. Address of Operator

P.O. Box 5970, Hobbs, NM 88241-5970

4. Well Location

Unit Letter D : 810 Feet From The NORTH Line and 610 Feet From The WEST Line

Section 5 Township 17S Range 33E NMPM LGA County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Rig up workover unit 4.16.93. Lay down rods & pump. Worked tubing
2hrs. attempting to release pkr. Resumed pkr release operation next day - no
luck. On 4.18.93, rig up wireline, cut tubing @ 10,220'. LD 94 fts. 2 7/8".
Ran & set CIBP @ 10,215' and dumped 35' cement on top of BP.
ND well head. Cut csg. below well head. Remove slips. On 4.19.93, PU spear,
worked csg.-based on stretch, cut 5 1/2" csg. @ 3059'. LD same. Ran 2 3/8" tbg.
circ. hole w/ gelled brine; pulled & LD tbg. to 4500'. Set 100' cement plug 50'-50'.
Pulled & LD tbg to 3089'. Set 50sx. cmt plug 50'-50' @ 5 1/2" stub.
On 4.20.93, tagged plug @ 2933'. Pulled & set 50 sx. cmt. plug @ 400'. Cut off
well head & set 10 sx. plug @ surface. Install DH marker & cut off anchors. Clean up loc.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

M. Y. Merchant

TITLE

President

DATE

4/21/93

TYPE OR PRINT NAME

M. Y. (Merc) Merchant

(505) 397-3596

TELEPHONE NO.

(This space for State Use)

APPROVED BY

Johnny Robinson

TITLE

DATE

AUG 24 2001

CONDITIONS OF APPROVAL, IF ANY:

3
2
6

C. G. N. N

E