

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO REOPEN OR REWORK A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT TO DRILL C-101 FOR SUCH PROPOSALS.)

1. ☐ OIL WELL ☐ GAS WELL ☒ OTHER: Water Injection Well

2. Name of Operator
Southland Royalty Company

3. Address of Operator
1100 Wall Towers West, Midland, Texas 79701

4. Location of Well
UNIT LETTER C 660 FEET FROM THE North LINE AND 1980 FEET FROM
THE West LINE, SECTION 7 TOWNSHIP 17S RANGE 33E NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)
4231' GR

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.
B-2516

7. Unit Agreement Name

8. Form or Lease Name
State "A"

9. Well No.
2

10. Field and Pool, or Wildcat
Maljamar (G-SA)

12. County
Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Call NMOCC prior to RU. Hobbs Office.
 2. MIRU csg PU. Pick up 2 3/8" work string.
 3. RIH w/tbg open ended.
 4. Spot 100' cmt on top of CIBP @ 4000'.
 5. PU & spot 100' cmt plug 3500' to 3400'. POOH.
 6. Cut 5 1/2" csg @ 3300'±. POOH & lay down 5 1/2".
 7. RIH w/tbg open ended and spot 100' cmt plug across 5 1/2" stub (50' in & out).
 8. PU & spot 100' cmt plug across 8 5/8" csg shoe @ 1281' (50' in & out). POOH.
 9. Perf 8 5/8" csg w/2 sqz shots @ 350'±.
 10. Establish circulation through perfs. Circulate cement to surface & leave 50'± cmt inside csg.
 11. PU & spot 10 sx cmt plug @ surface. Lay down workstring. RD PU.
 12. Install surface marker.
 13. Clean up location.
- *NOTE: Spot 10 ppg mud between cmt plugs.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Trey H. Ray TITLE District Operations Engineer DATE 6/9/82

ORIGINAL SIGNED BY JERRY SEXTON DATE JUN 11 1982

APPROVED BY JERRY SEXTON TITLE DISTRICT SUPERVISOR

CONDITIONS OF APPROVAL Verbal OK by Jerry