

DETAILS OF WORK CONTINUED

Humble Oil & Refining Company

Federal Elliott No. 1

W. Lovington Plains W/C

the plug, 19) Pull tubing, 20) Perforate from 12,000 to 12,060 feet with 4 jet shots per foot, 21) Set Baker Model "D" packer above perforations, 22) Run tubing, displace mud in tubing with water and test, 23) Treat through perforations with 2000 gallons of acid and test - if zone is productive, complete.

Note: Two or more of the zones tested may be combined in final completion. If any zone tested is productive of oil or gas but not in sufficient quantity to warrant completion before the higher zones are perforated and tested, it should not be cemented. The upper zone could be tested by running a blank tail pipe through the packer above such zone with enough seal nipples to assure separation of the zones. If all zones tested prove to be non-commercial, immediate abandonment is suggested while rig is on the well.

*E. M. G. Miller*

1944-1945

1944-1945

1944-1945

1944-1945

1944-1945

1944-1945