ubmit 3 Copies Appropriate	Energy inerals and Natural R	exico esources Department	Form C-103 Revised 1-1-89
NSTRICT I .O. Box 1980, Hobbs, NM 88240	A 88240 OIL CONSERVATION DIVISION P.O. Box 2088		WELL API NO.
DISTRICT II Santa Fe, New Mexico 87504-2088 P.O. Drawer DD, Artesia, NM 88210		30-025-01909 5. Indicate Type of Lease	
DISTRICT III 000 Rio Brazos Rd., Aztec, NM 87410			6. State Oil & Gas Lease No.
UN RE DIREE RE., Auv., I'll 01410			
(DO NOT USE THIS FORM FOR PRO DIFFERENT RESEN (FORM C	ICES AND REPORTS ON WE OPOSALS TO DRILL OR TO DEEPEN RVOR. USE "APPLICATION FOR PE -101) FOR SUCH PROPOSALS.)	OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
Type of Well: OL GAS WELL WELL X	OTHER		York ARQ
Name of Operator YATES PETROLEUM CORPOR	ΑΤΤΟΝ		8. Well No.
Address of Operator		<u></u>	9. Pool name or Wildcat
105 South 4th St., Artesia, NM 88210		Kemnitz Morrow	
Well Location		10	
Unit Letter:	Feet From The South	Line and	980 Feet From The East Line
Section 12	Township 16S R	ange 34E	NMPM Lea County
	10. Elevation (Show whether	DF, RKB, RT, GR, etc.)	VIIIIIIII
)68' GR	
1. Check	Appropriate Box to Indicate		
NOTICE OF IN	TENTION TO:	SUE	BSEQUENT REPORT OF:
		REMEDIAL WORK	
	CHANGE PLANS		
		CASING TEST AND C	
		OTHER: Re-ent	ry XX
e e come te			
	ntione (Clearly state all pertinent details	and give pertinent dates, inclu	whine estimated date of starting any proposed
Describe Proposed or Completed Oper- work) SEE RULE 1103.			uding estimated date of starting any proposed
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off	location. Dug out çe		w <i>ding estimated date of starting any proposed</i> le marker. Welded on 22" X 5K
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8	location. Dug out çe -5/8" casing stub.	llar and dry ho	le marker. Welded on 22" X 5K
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 4-17-98 - Moving in a	location. Dug out çe -5/8" casing stub. nd rigging up rotary t	llar and dry ho	le marker. Welded on 22" X 5K d cellar and dug reserve pits.
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 <u>4-17-98</u> - Moving in a 4-18-98 - Rigging up	location. Dug out ce -5/8" casing stub. nd rigging up rotary t rotary tools. Dug rat	llar and dry ho ools. Installe and mouse hole	ele marker. Welded on 22" X 5K ed cellar and dug reserve pits. es.
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 <u>4-17-98</u> - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1	location. Dug out ce -5/8" casing stub. nd rigging up rotary t rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98.	llar and dry ho ools. Installe and mouse hole Nippled up BO	ole marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 4-17-98 - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'.	location. Dug out çe -5/8" casing stub. nd rigging up rotary t rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string	llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u	ole marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork ap flowline and choke lines.
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 <u>4-17-98</u> - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan	location. Dug out çe -5/8" casing stub. nd rigging up rotary t rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string gged upper and lower va	llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled	ole marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 <u>4-17-98</u> - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and	location. Dug out çe -5/8" casing stub. nd rigging up rotary t rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed	llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head	ole marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 <u>4-17-98</u> - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a	location. Dug out ce -5/8" casing stub. nd rigging up rotary t rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed and tagged up at 3777'.	llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3	ole marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 3670-3830'. Tested casing to
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 4-17-98 - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a 1800#, OK, Washed fr	location. Dug out ce -5/8" casing stub. nd rigging up rotary t rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed and tagged up at 3777'.	llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3 Resumed drilli	ele marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 8670-3830'. Tested casing to ing at 4:30 PM 4-19-98.
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 4-17-98 - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a 1800#, OK. Washed fr 4-21-98 - TD 10454'. pipe from $4604-7900$ '	location. Dug out ce -5/8" casing stub. nd rigging up rotary to rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed and tagged up at 3777'. com 3830-4604'. NOTE: TIH with drillpipe. Washed from 7872-799	<pre>llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3 Resumed drilli Made 5850' in 1 P6' (tag plug at</pre>	ele marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork ap flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 8670-3830'. Tested casing to ing at 4:30 PM 4-19-98. 15-1/2 hours. TIH with drill c 7900' - fell out of plug at
2 Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 4-17-98 - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a 1800, OK. Washed fr 4-21-98 - TD 10454'. pipe from $4604-7900$ '	location. Dug out ce -5/8" casing stub. nd rigging up rotary to rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed and tagged up at 3777'. com 3830-4604'. NOTE: TIH with drillpipe. Washed from 7872-799	<pre>llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3 Resumed drilli Made 5850' in 1 P6' (tag plug at</pre>	ele marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 8670-3830'. Tested casing to ing at 4:30 PM 4-19-98. US-1/2 hours. TIH with drill 7900' - fell out of plug at hed from 9195-9624' (tag plug at
12 Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 4-17-98 - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a 1800, OK. Washed fr 4-21-98 - TD 10454'. pipe from 4604-7900'. 7960'). Ptocked up dr	location. Dug out ce -5/8" casing stub. nd rigging up rotary t rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed and tagged up at 3777'. com 3830-4604'. NOTE: TIH with drillpipe. Washed from 7872-799 cill pipe. TIH from 79	<pre>llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3 Resumed drilli Made 5850' in 1 06' (tag plug at 96-9229'. Wash mabedia.</pre>	ele marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 8670-3830'. Tested casing to ing at 4:30 PM 4-19-98. L5-1/2 hours. TIH with drill 7900' - fell out of plug at hed from 9195-9624' (tag plug at CONTINUED ON NEXT PAGE:
12. Describe Proposed or Completed Operwork) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 <u>4-17-98</u> - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a 1800#, OK. Washed fr 4-21-98 - TD 10454'. pipe from 4604-7900'. 7960'). Picked up dr I hereby certify that the information above is to With the second secon	location. Dug out ce -5/8" casing stub. nd rigging up rotary to rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed and tagged up at 3777'. com 3830-4604'. NOTE: TIH with drillpipe. Washed from 7872-799	<pre>llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3 Resumed drilli Made 5850' in 1 06' (tag plug at 96-9229'. Wash modelar.</pre>	ele marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 8670-3830'. Tested casing to ing at 4:30 PM 4-19-98. L5-1/2 hours. TIH with drill 7900' - fell out of plug at hed from 9195-9624' (tag plug at CONTINUED ON NEXT PAGE:
12. Describe Proposed or Completed Operwork) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 <u>4-17-98</u> - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a 1800#, OK. Washed fr 4-21-98 - TD 10454'. pipe from 4604-7900'. 7960'). Picked up dr	location. Dug out ce -5/8" casing stub. nd rigging up rotary t rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed ind tagged up at 3777'. rom 3830-4604'. NOTE: TIH with drillpipe. Washed from 7872-799 rill pipe. TIH from 79 resolvemples to the best of my knowledge and March 1997 - 1997	<pre>llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3 Resumed drilli Made 5850' in 1 06' (tag plug at 96-9229'. Wash modelar.</pre>	<pre>de marker. Welded on 22" X 5K d cellar and dug reserve pits. es. DP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 8670-3830'. Tested casing to ing at 4:30 PM 4-19-98. L5-1/2 hours. TIH with drill c 7900' - fell out of plug at hed from 9195-9624' (tag plug at CONTINUED ON NEXT PAGE: Technician April 27, 1998</pre>
12 Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 <u>4-17-98</u> - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a 1800#, OK. Washed fr 4-21-98 - TD 10454'. pipe from 4604-7900'. 7960'). Picked up dr I hereby certify that the information above is to SKONATURE Way Kleit TYPE OR PRINT NAME	location. Dug out ce -5/8" casing stub. nd rigging up rotary to rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed and tagged up at 3777'. rom 3830-4604'. NOTE: TIH with drillpipe. Washed from 7872-799 rill pipe. TIH from 79 read complete to the best of my knowledge and Market from 79 read complete to the best of my knowledge and Market from 79 read complete to the best of my knowledge and Market from 79 read complete to the best of my knowledge and Market from 79 read complete to the best of my knowledge and Market from 79 read complete to the best of my knowledge and Market from 79 Market	<pre>llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3 Resumed drilli Made 5850' in 1 06' (tag plug at 96-9229'. Wash modelar.</pre>	ele marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 8670-3830'. Tested casing to ing at 4:30 PM 4-19-98. US-1/2 hours. TIH with drill 7900' - fell out of plug at hed from 9195-9624' (tag plug at
12 Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 4-17-98 - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a 1800#, OK. Washed fr 4-21-98 - TD 10454'. pipe from 4604-7900'. 7960'). Ptocked up dr I hereby certify that the information above is to SKONATURE	location. Dug out ce -5/8" casing stub. nd rigging up rotary to rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed ind tagged up at 3777'. com 3830-4604'. NOTE: TIH with drillpipe. Washed from 7872-799 ill pipe. TIH from 79 we and complete to the best of my knowledge and MARINE WILLIAME	<pre>llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3 Resumed drilli Made 5850' in 1 06' (tag plug at 96-9229'. Wash modelar.</pre>	ole marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 8670-3830'. Tested casing to ing at 4:30 PM 4-19-98. US-1/2 hours. TIH with drill 7900' - fell out of plug at hed from 9195-9624' (tag plug at CONTINUED ON NEXT PAGE: Technician DATE April 27, 1998 TELEPHONE NO. 505/748-1
12 Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 <u>4-17-98</u> - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a 1800#, OK. Washed fr 4-21-98 - TD 10454'. pipe from 4604-7900'. 7960'). Picked up dr I hereby certify that the information above is to SKONATURE Way Kleit TYPE OR PRINT NAME	location. Dug out ce -5/8" casing stub. nd rigging up rotary to rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed and tagged up at 3777'. rom 3830-4604'. NOTE: TIH with drillpipe. Washed from 7872-799 rill pipe. TIH from 79 read complete to the best of my knowledge and MANNE AND AND AND AND AND AND AND AND AND IN	<pre>llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3 Resumed drilli Made 5850' in 1 06' (tag plug at 96-9229'. Wash modelar.</pre>	<pre>ele marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. DP and tested to 5000#. Daywork ap flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 8670-3830'. Tested casing to ing at 4:30 PM 4-19-98. E5-1/2 hours. TIH with drill c 7900' - fell out of plug at hed from 9195-9624' (tag plug at CONTINUED ON NEXT PAGE: Technician April 27, 1998</pre>
2. Describe Proposed or Completed Oper work) SEE RULE 1103. 4-16-98 - Scraped off slip on wellhead on 8 <u>4-17-98</u> - Moving in a 4-18-98 - Rigging up 4-19-98 - Finished ri operations began at 1 4-20-98 - TD 4604'. Picked up kelly, chan up drill collars and up drill pipe. TIH a 1800#, OK. Washed fr 4-21-98 - TD 10454'. pipe from 4604-7900'. 7960'). Ptcked up dr I hereby certify that the information above is to skonature Rusty Klef	location. Dug out ce -5/8" casing stub. nd rigging up rotary to rotary tools. Dug rat gging up rotary tools. 2:00 AM 4-19-98. Drilling cement string ged upper and lower va drill pipe. Installed and tagged up at 3777'. rom 3830-4604'. NOTE: TIH with drillpipe. Washed from 7872-799 rill pipe. TIH from 79 read complete to the best of my knowledge and MANNE AND AND AND AND AND AND AND AND AND IN	<pre>llar and dry ho ools. Installe and mouse hole Nippled up BO ers. Nippled u lves. Drilled rotating head Washed from 3 Resumed drilli Made 5850' in 1 06' (tag plug at 96-9229'. Wash me Operations</pre>	ole marker. Welded on 22" X 5K ed cellar and dug reserve pits. es. OP and tested to 5000#. Daywork up flowline and choke lines. cement plug at surface. Picked rubber and circulated. Picked 8670-3830'. Tested casing to ing at 4:30 PM 4-19-98. US-1/2 hours. TIH with drill 7900' - fell out of plug at hed from 9195-9624' (tag plug at CONTINUED ON NEXT PAGE: Technician DATE April 27, 1998 TELEPHONE NO. 505/748-1