EASERGY AND MINERALS DEPARTMENT OIL CONSERVATION DIVISION P. O. BOX 2088 SANTA FE, NEW MEXICO 87501	Form C-103 Revised 10-1-78
U.S.O.S. LAND OFFICE OPERATOR	Sa. Indicate Type of Lease State Fee 5. State Oil 6 Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DAILL OR TO DEEPEN OF PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	
1. 01L SAB OTHER-	7. Unit Agreement Name
2. Name of Operator Chevron U.S.A. Inc.	8. Form or Lease Name State TD
P.O. Box 670 Hobbs, NM 88240	9. Well No.
4. Location of Well UNIT LETTER X 990 FEET FROM THE South LINE AND 990 FEET FROM	10. Field and Pool, or Wildcan Towsend Permo Upper Penr
THE East LINE, SECTION 2 TOWNSHIP 165 RANGE 35E NMPM	
15. Elevation (Show whether DF, RT, GR, etc.) 3992 DF	12. County Lea
Check Appropriate Box To Indicate Nature of Notice, Report or Ot NOTICE OF INTENTION TO: SUBSEQUEN	her Data F REPORT OF:
PERFORM REMEDIAL WORE     PLUG AND ABANDON     REMEDIAL WORE     X       TEMPORARILY ABANDON     COMMENCE DRILLING OPHS.     COMMENCE DRILLING OPHS.     I       PULL OR ALTER CABING     CHANGE PLANS     CASING TEST AND CEMENT JQB	ALTERING CASING
OTHER	[_]
17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including work) SEE RULE 1703. Ran CNL/CCL/GR logs. Set RBP @ 10323. Tested RBP to 1000 psi. Perfo 10282 (18 holes). Set packer @ 10228. Acidized with 1500 gallons 15%	rated from 10272

with new packer set 0 10196. Acidized with 500 gallons 20% NEFE HCL. PU retrieving tool and latch RBP. Worked to release RBP. Tubing parted. PU overshot and latch fish @ 7870. Worked to release RBP, would not release. Backed off and recovered 75 joints 2 3/8 tubing. Latch fish @ 10171. Attempt to jar on fish, no success. Attempt to circulate, found obstruction in tubing @ 10215. Backed off @ 10202. Recovered 1 joint 2 3/8 tubing. Screw into fish @ 10202. Bail sand and parafin to 10224. RU coiled tubing unit and washed to 10239. (Unable to wash past 10239.) Bail sand to 10262. Cut tubing @ 10251. PU wash pipe and power swivel. Attempt to wash over fish, made no footage after cutting into rubber on RBP. TIH with overshot. Worked over fish and recovered  $1\frac{1}{2}$  joints 2 3/8 tubing with top nut of retrieving tool. TIH with short catch overshot and jar on fish. Pulled off fish. PU washpipe and power swivel. Attempt to wash over RBP. TIH with overshot and jar on fish. Pulled off fish and left grapple in hole. PU washpipe and power swivel. Attempt to mill over fish, made 1'. (Ring between rubbers on RBP turning and will not drill up.) TIH with overshot and jar on fish. Overshot pulled off and left grapple in hole. Aborted fishing operations. Fish left in hole consist of RBP and 3 3/8" grapple. Ran rods and tubing back in hole. Well is closed in pending evaluation.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

TITLE Division Drilling Manager DATE 1-2-1985 ORIGINAL SIGNED BY JEARY SEXTON **DISYRICT I SUPERVISOR** JAN6 - 1986 Straine 1/61

na na na

RECOVED JAN 3-1986 O.C.D. HOBES OFFICE