

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO RE-OPEN OR PLUG BACK TO A DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT TO DRILL (FORM C-101) FOR SUCH PROPOSALS.)		5a. Indicate Type of Lease State ☒ Fee ☐
1. Name of Operator RALPH E. WILLIAMSON		7. Unit Agreement Name
2. Address of Operator P. O. Box 994 Midland, Texas 79702		8. Farm or Lease Name Harrod
3. Location of Well UNIT LETTER <u>U</u> <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>4</u> TOWNSHIP <u>16S</u> RANGE <u>35E</u> N.M.P.M.		9. Well No. 1
10. Field and Pool, or Widest Townsend Strawn		11. Elevation (Show whether DF, RT, GR, etc.) 4043' DF
12. County LEA		

 
Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐ TEMPORARILY ABANDON ☐ PLUG OR ALTER CASING ☐ OTHER ☐	PLUG AND ABANDON ☐ CHANGE PLANS ☐	REMEDIAL WORK ☐ COMMENCE DRILLING OPNS. ☐ CASING TEST AND CEMENT JOBS ☐ OTHER ☐	ALTERING CASING ☐ PLUG AND ABANDONMENT ☒
--	---	---	---

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Move in & rig up unit & auxiliary equipment. (wireline, pump truck & cement truck.)
Killed well with pump. Unset packer. Pull production tubing out of hole.
Set CIBP @ 11,280'. Tag with tubing and spot 5 sks. of cement on BP.
Pull out of hole @ 10,550' and spot 25 sks. Could not load hole with brine gel.
Run in hole @ 10,250'. Spot 25 sks. of cement with lost circulation material. Wait on cement.
Run in hole @ 9552'. Circulate casing with brine gel. Pull out of hole. Rig up casing jack.
Pull slips on 4 1/2" casing. Cut casing @ 8293'. Lay down casing. Run in hole @ 8347'
with tubing. Spot 50 sks. of cement. WOC. Tag @ 8288'.
Spot 15 sks. of cement @ 8288'. Circulate hole with brine gel. Spot 25 sks. of cement
@ 7576'. Pull out of hole @ 6181'. Spot 25 sks. of cement. Pull out of hole @ 4597'.
Spot 50 sks. Tag @ 4480'. Pull out of hole @ 1790'. Spot 40 sks. of cement. Pull out
of hole @ 412'. Spot 40 sks. of cement. Tag @ 299'. Pull out of hole @ 10'. Spot 10 sk.
top hole plug. Install P & A Marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.
Plug & Abandonment Supv. BABER WELL SERVICE 2-8-88

MOVED BY 	TITLE <u>OIL & GAS INSPECTOR</u>	DATE <u>FEB 29 1988</u>
CONDITIONS OF APPROVAL, IF ANY:		

RECEIVED
FEB 10 1988
OCD
HOBBS OFFICE