

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

Jun 21 11 42 AM '66

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- Plug and Abandon		7. Unit Agreement Name
2. Name of Operator Sinclair Oil & Gas Company		8. Farm or Lease Name Hulda A. Townsend
3. Address of Operator P. O. Box 1920, Hobbs, New Mexico		9. Well No. 1
4. Location of Well UNIT LETTER J 1650 FEET FROM THE South LINE AND 2310 FEET FROM THE East 7 LINE, SECTION 7 TOWNSHIP 16S RANGE 35E NMPM.		10. Field and Pool, or Wildcat Fidson Pennsylvania
15. Elevation (Show whether DF, RT, GR, etc.) 4347' GR		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK	<input type="checkbox"/>
TEMPORARILY ABANDON	<input type="checkbox"/>
PULL OR ALTER CASING	<input type="checkbox"/>
OTHER	<input type="checkbox"/>

PLUG AND ABANDON	<input type="checkbox"/>
CHANGE PLANS	<input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK	<input type="checkbox"/>	ALTERING CASING	<input type="checkbox"/>
COMMENCE DRILLING OPNS.	<input type="checkbox"/>	PLUG AND ABANDONMENT	<input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOB	<input type="checkbox"/>		
OTHER	<input type="checkbox"/>		

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-18-65 Pulled tubing and left anchor in hole. Spotted 25 sacks cement plug @ 6800', top of cement 6690'. Filled hole w/heavy mud. Shot 5-1/2"OD casing off @ 6250' and pulled. Set 30 sacks cement plug @ 6250' top of 5-1/2"OD casing stub, top of cement @ 6130'. Set 25 sacks cement plug @ 4646', top of cement @ 4530'. Shot 8-5/8"OD casing off @ 700' and pulled. Set 30 sacks cement @ 715' in top of 8-5/8"OD casing stub, top of cement @ 665'. Set 30 sacks cement plug @ 324', top of cement @ 284' and 10 sacks in top of 13-3/8"OD casing and cellar. Set regulation dry hole marker, cleaned and levelled location. P&A eff; 1-9-66.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED	TITLE Superintendent	DATE 1-20-66
APPROVED BY	TITLE	DATE

CONDITIONS OF APPROVAL, IF ANY:

Orig: 2cc: OCC Hobbs, cc: Regional Office, cc: file