Submit 3 Copies to Appropriate Dutrict Office	State of New Mexico Energy, Minerals and Natural Resources Department		Form C-103 Revised 1-1-89	
DISTRICT 1 P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVATIO P.O. Box 208		WELL API NO.	· · · · · · · · · · · · · · · · · · ·
DISTRICT II	Santa Fe, New Mexico 87504-2088		<u>30-025-02786</u>	
P.O. Drawer DD, Artesis, NM 88210 DISTRICT III			5. Indicate Type of	
1000 Rio Brazos Rd., Aztec, NM 87410			6. Statu Oil & Gas	Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			7. Lesse Name or U	Juit Agreement Name
1. Type of Well: Of GAS WELL X	OTHER] Runn	els ASP
2. Name of Operator			8. Well No.	
YATES PETROLEUM CORPORATION 3. Address of Operator		9. Pool name or Wildcat		
105 South 4th St., Art	esia, NM 88210			and Morrow
4. Well Location		······································	• · · · · · · · · · · · · · · · · · · ·	
Unit Letter <u>H</u> : <u>1980</u>) Feet From The North	Line and660	Feet From	The East Line
Section 11	Township 16S Ram		NMPM	Lea County
	10. Elevation (Show whether 1	DF, RKB, RT, GR, etc.) 771 GR		
n. Check	Appropriate Box to Indicate N		mort or Other	//////////////////////////////////////
			SEQUENT RE	
	()			(^m)
		COMMENCE DRILLING		
ULL OR ALTER CASING		CASING TEST AND CE		
THER:	[]	OTHER: <u>Re-entry</u>	with rotary	tools X
	tions (Clearly state all pertinent details, and	i give persinent dates, includ	ling estimated date of s	tarting any proposed
work) SEE RULE 1103. 3-8-99 - Moved in rot	ary tools			
	rigged up rotary tools	. Rig repair.	Ninnled un	
2 10 00 TTD 59001			mippica ap	BOP.
3-10-33 - 1D 2000 .	Tested BOP to 5000#, OK	. Changed out	kelly valves	and rigged up lay
down machine. Picked Tested casing to 1000	Tested BOP to 5000#, OK up drill collars and d #, OK. Drilled cement	. Changed out rill pipe. Tag	kelly valves ged cement a	and rigged up lay t 4275'. Circulated
down machine. Picked Tested casing to 1000 pipe.	up drill collars and d #, OK. Drilled cement	. Changed out rill pipe. Tag from 4275-4575'	kelly valves ged cement a . Circulated	and rigged up lay t 4275'. Circulated d. Picked up drill
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'.	up drill collars and d #, OK. Drilled cement Washing and reaming. T	. Changed out rill pipe. Tag from 4275-4575' agged cement at	kelly valves ged cement a . Circulate 6102'. Circ	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'. cement from 6102-6225 down lay down machine	up drill collars and d #, OK. Drilled cement Washing and reaming. T '. Picked up drillpipe . Washed and reamed fr	. Changed out rill pipe. Tag from 4275-4575' agged cement at . Tagged up at	kelly valves ged cement a . Circulate 6102'. Circ 6400'. Circ	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled culated and rigged
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'. cement from 6102-6225 down lay down machine reamed from 7412-7603	up drill collars and d #, OK. Drilled cement Washing and reaming. T '. Picked up drillpipe . Washed and reamed fr	. Changed out rill pipe. Tag from 4275-4575' agged cement at . Tagged up at om 6400-7412'.	kelly valves ged cement a . Circulated 6102'. Circ 6400'. Circ Circulated.	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled culated and rigged Washed and
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'. cement from 6102-6225 down lay down machine reamed from 7412-7603 3-12-99 - TD 9460'.	up drill collars and d #, OK. Drilled cement Washing and reaming. T '. Picked up drillpipe . Washed and reamed fr '. Washing and reaming. W	. Changed out rill pipe. Tag from 4275-4575' agged cement at . Tagged up at om 6400-7412'. ash and ream fr	kelly valves ged cement a . Circulate 6102'. Circ 6400'. Circ Circulated. om 7630-8245	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled culated and rigged Washed and
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'. cement from 6102-6225 down lay down machine reamed from 7412-7603 3-12-99 - TD 9460'. rotating head rubber. at 8369-8469'.	up drill collars and d #, OK. Drilled cement Washing and reaming. T '. Picked up drillpipe . Washed and reamed fr '. Washing and reaming. W Wash and ream from 82	. Changed out rill pipe. Tag from 4275-4575' agged cement at . Tagged up at om 6400-7412'. ash and ream fr 45-9460'. NOTE	kelly valves ged cement a . Circulate 6102'. Circ 6400'. Circ Circulated. om 7630-8245 : Did not f	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled culated and rigged Washed and '. Installed ind cement plug
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'. cement from 6102-6225 down lay down machine reamed from 7412-7603 3-12-99 - TD 9460'. rotating head rubber. at 8369-8469'. 3-13-99 - Reaming at	up drill collars and d #, OK. Drilled cement Washing and reaming. T '. Picked up drillpipe . Washed and reamed fr '. Washing and reaming. W Wash and ream from 82 1]032'. Washed and rea	. Changed out rill pipe. Tag from 4275-4575' agged cement at . Tagged up at om 6400-7412'. ash and ream fr 45-9460'. NOTE med from 8721-9	kelly valves ged cement a . Circulate 6102'. Circ 6400'. Circ Circulated. om 7630-8245 : Did not f 859. Reamed	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled culated and rigged Washed and '. Installed ind cement plug from 9859-10525'.
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'. cement from 6102-6225 down lay down machine reamed from 7412-7603 3-12-99 - TD 9460'. rotating head rubber. at 8369-8469'. 3-13-99 - Reaming at	up drill collars and d #, OK. Drilled cement Washing and reaming. T '. Picked up drillpipe . Washed and reamed fr '. Washing and reaming. W Wash and ream from 82 11032'. Washed and rea fund complete to the best of my knowledge and b	. Changed out rill pipe. Tag from 4275-4575' agged cement at . Tagged up at om 6400-7412'. ash and ream fr 45-9460'. NOTE med from 8721-9	kelly valves ged cement a . Circulated 6102'. Circ 6400'. Circ Circulated. om 7630-8245 : Did not f 859. Reamed CONTINUED O	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled culated and rigged Washed and '. Installed ind cement plug <u>from 9859-10525'.</u> N NEXT PAGE:
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'. cement from 6102-6225 down lay down machine reamed from 7412-7603 3-12-99 - TD 9460'. rotating head rubber. at 8369-8469'. 3-13-99 - Reaming at	up drill collars and d #, OK. Drilled cement Washing and reaming. T '. Picked up drillpipe . Washed and reamed fr '. Washing and reaming. W Wash and ream from 82 11032'. Washed and rea fund complete to the best of my knowledge and b	. Changed out rill pipe. Tag from 4275-4575' agged cement at . Tagged up at om 6400-7412'. ash and ream fr 45-9460'. NOTE med from 8721-9	kelly valves ged cement a . Circulated 6102'. Circ 6400'. Circ Circulated. om 7630-8245 : Did not f 859. Reamed CONTINUED O	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled culated and rigged Washed and '. Installed ind cement plug from 9859-10525'.
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'. cement from 6102-6225 down lay down machine reamed from 7412-7603 3-12-99 - TD 9460'. rotating head rubber. at 8369-8469'. 3-13-99 - Reaming at Ihereby certify that the information shows infere	up drill collars and d #, OK. Drilled cement Washing and reaming. T '. Picked up drillpipe . Washed and reamed fr '. Washing and reaming. W Wash and ream from 82 11032'. Washed and rea ford complete to the best of my knowledge and b	. Changed out rill pipe. Tag from 4275-4575' agged cement at . Tagged up at om 6400-7412'. ash and ream fr 45-9460'. NOTE med from 8721-9	kelly valves ged cement a . Circulated 6102'. Circ 6400'. Circ Circulated. om 7630-8245 : Did not f 859. Reamed CONTINUED O	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled culated and rigged Washed and '. Installed ind cement plug from 9859-10525'. N NEXT PAGE:
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'. cement from 6102-6225 down lay down machine reamed from 7412-7603 3-12-99 - TD 9460'. rotating head rubber. at 8369-8469'. 3-13-99 - Reaming at I hereby certify that performation above inter- suonature Busty Klad	up drill collars and d #, OK. Drilled cement Washing and reaming. T '. Picked up drillpipe . Washed and reamed fr '. Washing and reaming. W Wash and ream from 82 11032'. Washed and rea ford complete to the best of my knowledge and b	. Changed out rill pipe. Tag from 4275-4575' agged cement at . Tagged up at om 6400-7412'. ash and ream fr 45-9460'. NOTE med from 8721-9	kelly valves ged cement a . Circulated 6102'. Circ 6400'. Circ Circulated. om 7630-8245 : Did not f 859. Reamed CONTINUED O	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled culated and rigged Washed and '. Installed ind cement plug <u>from 9859-10525'.</u> N NEXT PAGE:
down machine. Picked Tested casing to 1000 pipe. 3-11-99 - TD 7603'. cement from 6102-6225 down lay down machine reamed from 7412-7603 3-12-99 - TD 9460'. rotating head rubber. at 8369-8469'. 3-13-99 - Reaming at I hereby certify that perturbation above inter- successful that perturbation above inter- station above inter- ation above inter- station above inter- st	up drill collars and d #, OK. Drilled cement Washing and reaming. T '. Picked up drillpipe . Washed and reamed fr '. Washing and reaming. W Wash and ream from 82 11032'. Washed and rea ford complete to the best of my knowledge and b	. Changed out rill pipe. Tag from 4275-4575' agged cement at . Tagged up at om 6400-7412'. ash and ream fr 45-9460'. NOTE med from 8721-9	kelly valves ged cement a . Circulated 6102'. Circ 6400'. Circ Circulated. om 7630-8245 : Did not f 859. Reamed CONTINUED O	and rigged up lay t 4275'. Circulated d. Picked up drill culated. Drilled culated and rigged Washed and '. Installed ind cement plug <u>from 9859-10525'.</u> N NEXT PAGE: