

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
<b>B-9970</b>	
7. Unit Agreement Name	
---	
8. Farm or Lease Name	
<b>Mexico "R"</b>	
9. Well No.	
<b>3</b>	
10. Field and Pool, or Wildcat	
<b>Eidson-Pennsylvanian</b>	
11. County	
<b>Lea</b>	

**SUNDRY NOTICES AND REPORTS ON WELLS**

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT --" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <b>Plugged and Abandoned</b>
2. Name of Operator <b>Skelly Oil Company</b>
3. Address of Operator <b>P. O. Box 1351, Midland, Texas 79701</b>
4. Location of Well UNIT LETTER <b>C</b> , <b>660</b> FEET FROM THE <b>North</b> LINE AND <b>1939</b> FEET FROM THE <b>West</b> LINE, SECTION <b>18</b> TOWNSHIP <b>16S</b> RANGE <b>35E</b> NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) <b>4057' DF</b>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:      SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPER. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Moved in and rigged up pulling unit 5-28-71.
- Attempted to pull packer, packer stuck at 10,540', cut off 2-3/8" OD tubing at 10,479'.
- Loaded hole with 200 bbls. mud, pulled tubing.
- Set cast iron bridge at 10,000', dumped 14' of cement on plug.
- Cut off 5-1/2" OD casing at 5500' and pulled.
- Spotted cement plugs as follows:

5505' - 5165', 50 sacks across stub of 5-1/2" OD casing

4660' - 4171', 50 sacks

10' - Surface, 15 sacks

All intervals not cemented were filled with 10# mud.

- Welded plate on 8-5/8" casing.
- Set 4" pipe as dry hole marker.

Well plugged and abandoned June 4, 1971.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED (Signed) J. R. Avent TITLE Dist. Adm. Coordinator DATE June 10, 1971

APPROVED BY John W. Rusey TITLE Geologist DATE AUG 6 1971

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

JUN 1 1971

OIL CONSERVATION COM.  
ROOM 1000