

COPIES RECEIVED	
TRIBUTION	
NT FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Superseder: Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. 08700

SUNDY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Cities Service Oil Company	8. Farm or Lease Name State BM
3. Address of Operator Box 1919 - Midland, Texas 79701	9. Well No. 2
4. Location of Well UNIT LETTER L 1980 FEET FROM THE South LINE AND 660 FEET FROM THE West LINE, SECTION 16 TOWNSHIP 15S RANGE 36E NMPM.	10. Field and Pool, or Wildcat Caudill Permo Penn
15. Elevation (Show whether DF, RT, GR, etc.) 3920 DF	12. County Lea

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

This well was plugged and abandoned in the following manner:

1. MIRU pulling unit and pulled rods and tubing.
2. Set a CIBP inside 5-1/2" casing @ 10402' and dumped 4 sacks cement on top of CIBP @ 10,402' - 10,367'.
3. Moved off pulling unit and MIRU casing puller and loaded hole with mud laden fluid.
4. Shot off and pulled 5236' of 5-1/2" casing.
5. Displaced a 35 sack cement plug 1/2 in and 1/2 out of 5-1/2" casing stub from 5286' - 5150'.
6. Displaced a 35 sack cement plug 1/2 in and 1/2 out of 8-5/8" casing stub from 4800' - 4700'.
7. Set a 10 sack cement surface plug in top of the 8-5/8" casing @ 30' - 0' with a 4" dry hole marker extending 4' above the surface to designate a plugged and abandoned location.
8. The location has been cleared of all material and debris.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Spaulder

TITLE Region Oper. Mgr.

DATE June 14, 1974

APPROVED BY John W. Runyan

TITLE Geologist

DATE JUN 17 1974

CONDITIONS OF APPROVAL, IF ANY: