State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

District Office

OIL CONSERVATION DIVISION

<u>DISTRICT I</u>	OIL COIL	OFICALIN	DIA DIAIO	1011				
1625 N. French Dr., Hobbs, NM 88240	I. French Dr., Hobbs, NM 88240 2 0 4 0 S. Pacheco			ſ	WELL API NO.			
DISTRICT II	Sa	nta Fe, New Mexic	o 87505					
811 S. First, Artesia, NM 88210	Ĺ	30-025-036						
DISTRICT III				[5. Indicate Type of Lease			
1000 Rio Brazos Rd, Aztec, NM 87410				1	STAT	εx	FEE	i
DISTRICT IV	L		ı					
2040 South Pacheco, Santa Fe, NM 87505	Į,	6. State Oil & Gas Lease No.						
					E-1667			ı
S	UNDRY NOTICES A	ND REPORTS ON	WELLS					
(DO NOT USE THIS FORM FOR F	PROPOSALS TO DRILL	L or TO DEEPEN O	R PLUG BACK TO	DA [7. Lease Name or Unit Agreement Name			
DIFFER	ENT RESERVOIR US	E "APPLICATION	FOR PERMIT"		_			
	(FORM C-101) FOR	SUCH PROPOSAL	LS)					
1. Type of Welt:	,							
OIL X G	AS				State GB			
	ÆLL	OTHER						
2. Name of Operator					8. Well No.			
C. W. TRAINER			·		1			
3. Address of Operator					9. Pool name or wildcut		Λ	
c/o OIL REPORTS & GAS	SERVICES, INC.,100	8 W. BROADWAY	, HOBBS, NM 8	8240	Caudill Res	mo-Pens	DENO	nian
4. Well Location							· l	, '
Unit Letter C : 6	60 Feet From The	NORTH	Line and	1988	Feet From The	WEST	Line	
Section 16 Township	15S Range	36E			NMPM	LEA	County	; Í
	10, Elevation (Show whethe	r DF, RKB, RT, GR, ect.) 3920 DF						
II. Check	Appropriate Box to	Indicate Nature	of Notice. Ren	ort. or Oth	er Data			
				,				

NOTICE OF INTENTION TO:				SUBSEQUENT REPORT OF:			
PERFORM REMEDIAL WORK		PLUG AND ABANDON		REMEDIAL WORK	ALTERING CASING		
TEMPORARILY ABANDON		CHANGE PLANS		COMMENCE DRILLING OPNS.	PLUG & ABANDONMENT		
PULL OR ALTER CASING				CASING TEST & CEMENT JOB			
OTHER:				OTHER: Re-Entry		X	

2/28/00 MIRU. NU BOP.

2/29/00 RU reverse equip. RIH w/ metal muncher & drill collar. Install stripper head. Mill on old dry hole marker cmt'd inside 8 5/8"

3/1/00-3/8/00 CO & circ, hole to 9887'.

3/9/00 Run 8689' 5 1/2" 17 & 20# N80 & J55 8rd csg.

3/13/00 Cut off 5 1/2" csg. Install tbg head & NU BOP. RIH w/drl collars & 272 jts tbg. CO to 8875'. Circ. hole clean.

3/14/00-3/17/00 CO to 9950'. Dri cmt to 10,540', Circ. hole clean.

3/20/00 RIH w/5.5" cmt retainer on 2 7/8" tbg set @ 10,103'. Test tbg to 5000#. Sqz Wolfcamp perfs w/100 sx Class "H" + 5% FL for total 21 bbls.cmt. Spot cmt to end of tbg, displaced w/fresh wtr. Pressure to 4300# & held. Start to reverse out cmt, would not circ. 3/21/00 RIH w/44 jts tbg. RU & tie into 2" outlets on tbg head w/blind rams on BOP shut. Break circ. down 5 1/2" csg w/15 bbls fresh wtr circ'd free. Pump 1300 sx cmt. open up BOP & insert 5 1/2" top rubber plug in 5 1/2" csg. Close BOP blind rams & displace w/197 bbls fresh wtr. Displaced plug down to 8550'. Circ'd 77 sx cmt to surf.

3/22/00 GIH w/2 7/8" tbg, tag @ 8311'. DO rubber plug then cmt down to 8560'. Circ hole clean.

3/23/00-3/29/00 Drl cmt from 8560'-10,295'. Circ. hole clean. Tagged @ 9930'. Drl cmt retainer @ 10,545'. Circ. hole clean.

Tag @ 10,547'. DO cmt to 10,594' & fall free. Circ'd hole clean. Tagged @ 13,294'.

3/30/00 Drl on CIBP. CIBP turned loose & pushed down hole to next CIBP @ 13,470'. Pump 3000 gals 15% NEFE acid down tbg & wash across perfs & up to 13,000'. Displace acid w/40 bbls wtr down tbg.

I hereby certify that the information above	ledge and belief.	Cont'd next page			
SIGNATURE BOLY SK	TITLE	AGENT	DATE	05/26/00	
TYPE OR PRINT NAME Gaye Heard		TEL	EPHONE NO. (505)	393-2727	
(THIS SPACE FOR STATE USE)	ORIGINAL S COMO			. ** **	410
APPROVED BY CONDITIONS APPROVAL, IF ANY:	ORIGINAL PICATE B	FORMER FULCIAME	D	ATE	<u> </u>