D. H. Crockett #1

- 1. Moved in and rigged up contract unit.
- 2. Killed well with water.
- 3. Pulled packer and tbg.
- 4. Reran tbg. with packer.
- 5. Spotted 100 sxs. Trinity Inferno below packer at 10,690 (Plugging of Caudill Devonian).

2 <u>/</u>

Ì

- 6. Tested tbg. found 10 bad joints. Pulled tbg.
- 7. Started rerunning tbg., however, couldn't get below 7500.
- 8. Reamed out hole from 7500 to 8700.
- 9. Reran tbg., rods and pump.
- 10. Put well to pumping. Tested.
- 11. Well produced only water.
- 12. Pulled tbg., rods and pump.
- 13. Set cast Iron Bridge plug at 10,650 and dumped one sx. of cement on top of plug.
- 14. Reran tbg, rods and pump.
- 15. Put well to pumping. Tested.
- 16. Produced only water.
- 17. Pulled pump, rods and tbg.
- 18. Acidized well with 1000 gals. N. E. retarded acid.
- 19. Reran pump, rods and tbg.
- 20. Put well to pumping. Failed to pump.
- 21. Pulled pump and rods. Repaired pump. Reran pump and rods.
- 22. Put well to pumping. Tested.
- 23. Well recompleted as a pumping oil well. Sucessful.