

NO. OF COPIES RECEIVED

DISTRIBUTION

SANTA FE

FILE

U.S.G.S.

LAND OFFICE

OPERATOR

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease

State ☒Fee ☐

5. State Oil & Gas Lease No.

E-529

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1.

OIL
WELL ☒GAS
WELL ☐

OTHER-

2. Name of Operator

EXXON CORPORATION

3. Address of Operator

P.O. BOX 1600, MIDLAND, TEXAS 79701

4. Location of Well

UNIT LETTER J 1980 FEET FROM THE SOUTH LINE AND 1980 FEET FROM
THE EAST LINE, SECTION 26 TOWNSHIP 15-S RANGE 36-E NMPM.

7. Unit Agreement Name

8. Farm or Lease Name

NEW MEXICO AT STATE

9. Well No.

2

10. Field and Pool, or Wildcat

DEAN PERMO PENN

15. Elevation (Show whether DF, RT, GR, etc.)

3871 DF

12. County

LEA

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐TEMPORARILY ABANDON ☐PULL OR ALTER CASING ☐PLUG AND ABANDON ☒CHANGE PLANS ☐OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐COMMENCE DRILLING OPNS. ☐CASING TEST AND CEMENT JOB ☐OTHER ☐ALTERING CASING ☐PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

PLUGGING PROCEDURE

1. WITH THE TBG. SEATED IN PACKER, CIRC. THE CSC. W/MUD CONSISTING OF 25# GEL/100 BLS. BRINE
2. UNSEAT THE TBG. AND ATTEMPT TO PUMP MUD BELOW PACKER (MAX. SURF. PRESS. 1500 PSI. IF UNABLE TO RELEASE FROM PACKER, A) CUT OFF TBG. ABOVE 1" LINE PIPE (200' ABOVE GWS SEPARATOR AT APPROX. 11,284') B) PULL TBG. AND SET BP JUST ABOVE CUT OFF TBG., C) CAP W/4 SX (25' CEMENT, D) PROCEED TO STEP 5 OF PROCEDURE.
3. PULL TBG. AND BOTTOM HOLE SEPARATOR W/200' OF 1" LINE PIPE STRAPPED TO 2 3/8".
4. SET A "DR" PLUG ON SAND LINE INTO MODEL D PACKER AT 11519 AND DUMP 4 SX CEMENT 25' ON TOP.
5. ESTABLISH FREE POINT AND CUT 5 1/2" CSC. ABOUT 1950'. PULL 5 1/2" CSC.
6. ESTABLISH FREE POINT AND CUT 8 5/8" CSC. ABOUT 1100'. PULL 8 5/8" CSC.
7. RUN TBG OPEN ENDED TO 5 1/2" CSC. CUT AND REFILL HOLE W/MUD.
8. SPOT 100' CLASS C CEMENT PLUG W/MUD AS FOLLOWS:
 - A. 30 SX FROM 2150' TO 50' ABOVE 5 1/2" CSC. CUT (ACROSS TOP OF RUSTLER)
 - B. 60 SX ACROSS 8 5/8" CUT.
 - C. 90 SX FROM 287-387 (ACROSS SURF. CSC. SEAT)
 - D. 10 SX AT SURFACE.
9. CLEAN UP LOCATION AND SET WELL MARKER
10. NOTIFY N.M.C.C. REP. TO INSPECT LOCATION

* Notify O.C.C. 24 hr.
Before setting bottom
plug

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED

TITLE

UNIT HEAD

DATE

5-17-73

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: